								37717C-07			
S	Е	R	V	Ι	С	Е	Ν	0	Т	Е	
377	717C P	PDH/SD)H/Jitte	er Tes	st Set		SUPERSEDE	S: NON	E		
Seri	ial Numt	bers: GB and	00000000 if Firmw	0/GB00 are Rev	0000825 vision fit	(nominal) ted is A.01	.49 or A.01.62				
Dis	play bl	ank and	d/or ins	trume	ent hun	g					
To	be Perfo	rmed by:	Qualifie	d Servi	ice Perso	nnel					
 Parts Required : Contact TNTD, Product Support, quoting model number, serial number, options fitted and current firmware revision Situation A firmware bug exists in firmware revisions A.01.49 and A.01.62 (main) which can cause a blank display and/or the instrument to be hung-up. This can occur if the instrument is power cycled when it has 1 sec resolution gating, the SMG is enabled and the instrument is switched off for a long time. 											
									Continue	ed	
							DATE: Dece	mber 199)7		

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:

MODIFICATION RECOMMENDED

ACTION CATEGORY:	IMMEDIATELY ON SPECIFIED FAILURE AGREEABLE TIME	STANDARDS: LABOR 0.5 Hours				
LOCATION CATEGORY:	CUSTOMER INSTALLABLE ON-SITE SERVICE CENTER	SERVICE INVENTORY:	RETURN SCRAP SEE TEXT	USED PARTS:	RETURN SCRAP SEE TEXT	
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: December 1998				
AUTHOR: DBG	ENTITY: E610	ADDITIONAL INFORMATION:				

© 1999 AGILENT TECHNOLOGIES PRINTED IN U.S.A.



Solution/Action

If any of the above symptoms are shown by the instrument, the short term solution to get the instrument back into working order is to leave the instrument powered on for at least 24 hours. If the instrument remains in the hung-up state, please contact TNTD, Product Support for further instructions.

A free firmware upgrade is available but the branch of firmware is dependant on a number of factors, contact TNTD, Product Support with model number, serial number, options fitted, and current firmware revision.

If the customer has more instruments of the same age and revision every effort should be made to upgrade these instruments also.