S E R V I C E N O T E

SUPERSEDES: None

37722A Digital Telecom Analyzer

Serial Numbers: 0000U00000 / 3106U00147

Never ending user programmable measurement test time (gates continuously)

Parts Required

Part No.	Prom Location - A2 Assy
37722-80018	A2U2
37722-80016	A2U66

A2U57

Situation:

37722-80019

Instruments below serial number 3106U00147 which have a FIRMWARE REVISION NUMBER (MAIN) of less than 3135 have the following bug:

Bug: When a measurement test time is set for more than 1 hour using USER PROGRAM-MABLE, the instrument never stops gating.

To display the FIRMWARE REVISION NUMBER (MAIN) use the OTHER key then select FIRMWARE & OPTION using the softkeys (the MORE softkey has to be used to bring up the FIRMWARE & OPTIONS field).

Continued

DATE: October 1993

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:			
MODIFICATION RECOMMENDED			
ACTION CATEGORY:	☐ IMMEDIATELY ■ ON SPECIFIED FAILURE ☐ AGREEABLE TIME	STANDARDS: Labor hrs	
LOCATION CATEGORY:	☐ CUSTOMER INSTALLABLE☐ ON-SITE☐ SERVICE CENTER	SERVICE RETURN USED RETURN INVENTORY: SCRAP PARTS: SCRAP SEE TEXT	
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBILITY UNTIL: October 1995	
AUTHOR: ER	ENTITY: 1400	ADDITIONAL INFORMATION:	

© 1993 AGILENT TECHNOLOGIES PRINTED IN U.S.A.




Solution/Action:

If a customer complains of the above problem, order and retrofit the following PROM parts. The Service Manual (p/n 37722-90001) comes with an Upgrading Instrument Function Section (Chapter 7, pages 7-1/2/3/4) which can be used to access, and replace the parts.

Note: This Service Note should be implemented upon customer complaint only.

Once retrofit is complete, perform instrument self-tests to confirm operation.

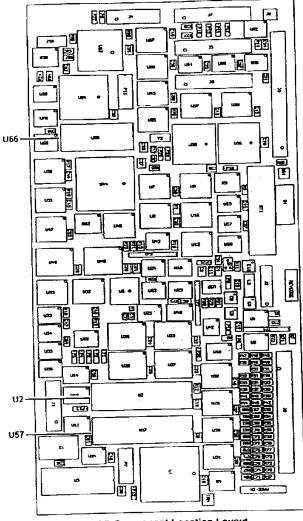

A2 Component Location Layout