8922E-02

HP 8922E GSM MS Test Set

0000A00000 to 9999Z99999

Y2K update information.

Product requires installation of 8922E to S upgrade kit 8922E #K51, which will upgrade to 8922S functionality and have latest firmware, to be Y2K compliant to HP standards.(see situation) 8922S firmware below B.07.07 is not Y2K compliant to HP standards.

Duplicate Service Notes: 8922ER-02

To Be Performed By: HP-Qualified Personnel

Parts Required:

HP P/N Description Quantity 8922E #K51 QMD Specials Option 1 QMD Specials options do not appear on CPL - see http://hpweb.sqf.hp.com/qmdman/specials/options/index.htm for details and contacts

Situation:

Y2K investigation has identified that the response from the BASIC function TIMEDATE is defective. This defect exists now and a TIMEDATE call would fail now if called in any BASIC application. Detection of this bug has caused all 8922 instruments below firmware B.07.07 (or C.01.03 for 8922P,R,X,Y) to be classified as Y2K non-compliant. This bug has not been reported by customers which implies that it has not used in any applications to date.

Failure to install the Y2K upgrade will not cause the HP8922E to return an incorrect date/time stamp on 1st January 2000.

Solution / Action:

8922E #K51 needs be installed to turn the 8922E into a 8922S with firmware above B.07.06 to meet HP Y2K compliance standards. This fixes the TIMEDATE bug but does not affect any other date-related processes within the instrument.

The 8922E will return the correct date/time stamp on 1st January 2000, without modification. It is recommended that no upgrade is required.

Date: 24 August 1998

* *	******	**********	* *
*			4
*	Mo	ODIFICATION AVAILABLE	4
*			4
*			4
*	REASON:	PERFORMANCE ENHANCEMENT X	4
*	-or-	SERVICE/RELIABILITY ENHANCEMENT	4
*	ACTION CATEGORY:	AGREEABLE TIME	4
*	LOCATION CATEGORY:	CUSTOMER INSTALLABLE ON-SITE	4
*		HP LOCATION _X	4
*	AVAILABLE UNTIL:	END OF SUPPORT LIFE	4
*	AUTHOR/ENTITY:	AS/E600	4
*	ADDITIONAL INFO:	QMD Specials options not on CPL- see above	4
*		-	4