S Ε R V I C Ε Ν E Т \mathbf{O} SUPERSEDES: NONE E8285A CDMA Mobile Station Test Set Serial Numbers: US0000000/US40272633 Power Supply Failure May Occur Using 220/240Vac Line Voltage To Be Performed By: Agilent Technologies-Qualified Personnel Parts Required: 0950-4059 Power Supply Situation: The original power supply (0950-2665) may fail when the Test Set is operated at high line voltage, 220/240 Vac. This service note does not cover failures occuring at low line voltages (100/110/120 Vac). This failure is caused by overstressed components in the power supply. The original power supply can be identified by the lack of a part number stamped on the sheet metal housing. Removal of the external cover and internal bottom cover are required to access the housing from the bottom of the Test Set. The replacement power supply has the part number, 0950-4059, stamped on the housing. Recalibration is not required after replacement of the power supply. **Solution / Action:** Replace the defective power supply with replacement part 0950-4059. Record the part number of the power supply being replaced on the CSO. If no part number is found on the power supply, enter 0950-2665 on the CSO.

DATE: June 2001

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:		
MODIFICATION RECOMMENDED		
ACTION CATEGORY:	 IMMEDIATELY ON SPECIFIED FAILURE AGREEABLE TIME 	STANDARDS: LABOR 0.5 Hours
LOCATION CATEGORY:	CUSTOMER INSTALLABLE	SERVICE □ RETURN USED □ RETURN INVENTORY: ■ SCRAP PARTS: ■ SCRAP □ SEE TEXT □ SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: June 2004
AUTHOR: EK	ENTITY: PL-13	ADDITIONAL INFORMATION:

© 2001 AGILENT TECHNOLOGIES PRINTED IN U.S.A.



E8285A-02