

S E R V I C E N O T E

SUPERSEDES:

E1300A B-size VXibus mainframe

Serial Numbers: See text.

Modification to eliminate intermittent opening of the line input fuse.

Duplicate Service Notes: E1300A-02, E1301A-03

To Be Performed By: Agilent-Qualified Personnel or by Customer

Parts Required:

Part No.	Description
2110-0029	Fuse, 125 V, 3A, Time-delay
2110-0304	Fuse, 250 V, 1.5A, Time-delay

Situation:

The input power fuses on the E1300A mainframe may open up during what are considered to be normal transient conditions on the line input (mains) supply voltage. This condition is usually intermittent and difficult to duplicate.

This problem may exist on any E1300A mainframe (serial prefixes of 2935A and 3034A) that has not been fitted with a time-delay fuse at the factory before shipping.

Continued

DATE: 06 April 1993

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:			
MODIFICATION RECOMMENDED			
ACTION CATEGORY:	<input type="checkbox"/> IMMEDIATELY <input checked="" type="checkbox"/> ON SPECIFIED FAILURE <input type="checkbox"/> AGREEABLE TIME	STANDARDS:	Labor 0.3 Hour
LOCATION CATEGORY:	<input checked="" type="checkbox"/> CUSTOMER INSTALLABLE <input type="checkbox"/> ON-SITE <input checked="" type="checkbox"/> SERVICE CENTER	SERVICE INVENTORY:	<input type="checkbox"/> RETURN <input type="checkbox"/> SCRAP <input checked="" type="checkbox"/> SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	USED PARTS:	<input type="checkbox"/> RETURN <input checked="" type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT
AUTHOR: KD	ENTITY: 0900	AGILENT RESPONSIBLE UNTIL: 06 April 1995	
		ADDITIONAL INFORMATION:	

Solution/Action:

If the above condition exists, replace the standard line input fuse with the appropriate time-delay fuse:

- 115 VOLT OPERATION (3 Amp): 2110-0029
- 230 VOLT OPERATION (1.5 Amp): 2110-0304