

E4829A/B-01B

Supersedes:
E4829A/B-01A
E1497A-01A
E4208B/C-02A

HP E4829A/B Parallel Cell/Traffic Generator and Analyzer System
involved product (bundled under E4829A):

HP E1497A V743 VXI Embedded Controller Module
HP E4208B/C VXI SCSI Disk Module

User Software (HP E4871A) Certification Numbers: 3534Gxxxxxx
DE358xxxxxx

Duplicate Service Notes:
E1497A-01B
E4208B/C-02B

Y2K update information. Product requires:
- HP-UX 10.20 as operating system as HP-UX 9.07 is not Y2K compliant
- ported User Software to HP-UX 10.20 (E4871B)
- 4GByte HD; included in upgrade kit HP E4871B #200.
- Memory Extention by 64MByte (recommended is HP P/N E2829A)

To Be Performed By: HP-Qualified Personnel or Customer

Parts Required (recommended):

HP P/N	Description	Quantity
HP E4871B #200	Upgrade Kit (4GByte HD, User SW HP E4871B)	1
HP A2829A	32MByte RAM	1

Situation:

1. The user software installed on the product (HP E4871A) is Y2K compliant.
2. The user software is currently running on the HP-UX revision 9.07. All HP Y2K test have been passed based on this operating system.
3. However, HP-UX revision 9.07 is not Y2k compliant. There may be Y2K compliancy issues with other applications or in a LAN based configuration.

Solution / Action:

1. To be Y2K compliant the product's operating system needs to be upgraded to HP-UX 10.20.
2. Additionally a new revision of the User Software HP E4871B ported to HP-UX 10.20 needs to be installed.
3. With HP-UX 10.20 a 4GByte HD is required. Please order:
HP E4871B #200 upgrade kit
4. To avoid performance shortfalls a memory upgrade to the controller HP E1497A by at least 32MByte is recommended.

Note: There are two memory banks available, one already loaded with an 32MByte RAM module. Therefore only one additional memory module can be installed for upgrade reasons!

Date:
Oct 1, 1999

```

*****
*
*           MODIFICATION RECOMMENDED           *
*           -----                             *
*
*           STANDARDS: LABOR HOURS  _4_____ *
*

```

```

* ACTION CATEGORY: ON SPECIFIED FAILURE ___ IMMEDIATELY ___ *
* AGREEABLE TIME before year 2000 *
* LOCATION CATEGORY: CUSTOMER INSTALLABLE ___ ON-SITE ___ *
* HP LOCATION _X *
* AVAILABILITY: PRODUCT'S SUPPORT LIFE *
* SERVICE INVENTORY: RETURN ___ SCRAP ___ SEE TEXT ___ *
* USED PARTS: RETURN ___ SCRAP ___ SEE TEXT ___ *
* HP RESPONSIBLE UNTIL: _____ *
* AUTHOR/ENTITY: _Peter Woellper, B100_____ *
* ADDITIONAL INFO: _____ *
*****

```

HP has made every effort to ensure the accuracy of our product testing. However, because each customer's environment is different from HP's laboratory test environment, it is the customer's responsibility to validate the Year 2000 readiness of these products in their own environment. Therefore, information about the Year 2000 status of HP products is provided "as is" without warranties of any kind and is subject to change without notice. HP makes no representation or warranty respecting the accuracy or reliability of information about non-HP products. Such information, if any, was provided by the manufacturers of those products and customers are urged to contact the manufacturer directly to verify Year 2000 readiness. The information provided here constitutes a Year 2000 Readiness Disclosure for purposes of the Year 2000 Information and Readiness Disclosure Act.