

## S E R V I C E N O T E

SUPERSEDES: NONE

**8751A Network Analyzer****Serial Numbers:** 0000J00000 / 3315J00792**Part number of new key cap for power line switch****To Be Performed By:** Agilent-Qualified Personnel**Duplicate Service Notes:** 8751A-24, 4396A-08, 87510A-08**Parts Required:**

<b>Part No.</b>	<b>Qty.</b>	<b>Description</b>
5060-4076	1	KEY CAP & ROD

**Situation:**

After the power line module is disassembled and re-assembled, the power line switch on the front panel may not work properly. Its key cap may be stuck at the front panel. This happens because the key cap length is shorter than the key stroke length.

**Solution/Action:**

Adjust the physical location of the power line module so that the power line switch can operate properly. Otherwise, replace the key cap and the key rod to the new one (P/N 5060-4076). The new part number 5060-4076 includes the key cap (formerly 5041-0564) and the key rod (formerly 04274-40001).

DATE: 15 November 1993

## ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:

**INFORMATION ONLY**

AUTHOR:

ENTITY:

MT

3355

ADDITIONAL INFORMATION:

