

Service Tip

VS-55

August, 1993

**MODEL(s): VS4001R, VS-4003R, VS-4501R, VS-4502R, VS-4503R,
VS-4504R, VS-5001R, VS-5002R, VS-5003R, VS-5004R,
VS-5010R, VS-5020R, VS-6002R, VS-6015R & VS-7001**

CHASSIS: V10 & V10B

SYMPTOM: LOSS OF VERTICAL DEFLECTION / IC401 FAILURE

Certain types of IC401 failure can place unusual stress on components C920 and D4000, resulting in a repeat failure of IC401, and **in extreme cases, damage to the DEFLECTION-PCB.**

To avoid the possibility of a repeat failure, it is strongly recommended that all three components be replaced simultaneously when IC401 fails for any reason.

All three components are available in kit form under the Part Number IC-401.



MITSUBISHI ELECTRONICS AMERICA, INC.
5665 Plaza Drive, Cypress, CA. 90630-0007