

For more Hi-Fi manuals and set-up information please visit www.hifiengine.com

CONFIDENTIAL



Service Bulletin

No. 006R1

Date: September 2, 2005

Model: TA-RW255

Subject: No Sound output from Deck "B" after switching from Deck "A".

Symptom: No Sound output from Deck "B" after switching from Deck "A". The symptom is the result of a programming error in the original Microprocessor.

Solution: Replace the Microprocessor with the improved version. After the Microprocessor has been replaced add the letter "A" to the end of the units Serial Number. Note: If version 1.00 is installed into a set that originally had version 1.01 the following error will occur: After Deck A is switched to Deck B in Continuous tape playback mode, sound will not be produced from Deck B.

Parts:

Ref#	FORMER		NEW	
	Description	Part Number	Description	Part
				Number
Q701	MPD78042FGF-	22242245R3	MPD78042FGF-	22242284R3
	140-3B9		141-3B9	

CONFIDENTIALITY NOTICE: