

TechInfo Sheet

fax: 01344 853689

Audio Visual

email: av.technical@mail.panasonic.co.uk

Product Group: VHS VTR

Model: NV-HD100B

Date: 25/09/98

Revision No: 01

Document No: 01

Subject: Clock Loses Time

SYMPTOM: The clock runs slow, about 1 sec a day. The specification is +/- 15 secs a month.

CAUSE: Due to the microprocessor's performance in different conditions (e.g. temperature, humidity, etc., around the VCR), the accuracy of count-up function for the clock can be effected.

REMEDY: Replace the Timer IC, IC7501 to new type.

<u>Old Part Number</u>	<u>New Part Number</u>	<u>Reference</u>	<u>Description</u>
MN187164VTSV	MN187164VZBE	IC7501	IC