

It may occur that - during playback or recording - the recorder is spontaneously set to the stop position before the end of the tape has been reached.

Remedy :

Install a 100-nF capacitor (code number 4822 121 41161) in parallel to C737 (560nF) of U301 or replace C737 by a 680-nF capacitor (code number 4822 121 40443).