



# Crimp 05 : R/A crimped cap

## COMPONENTS

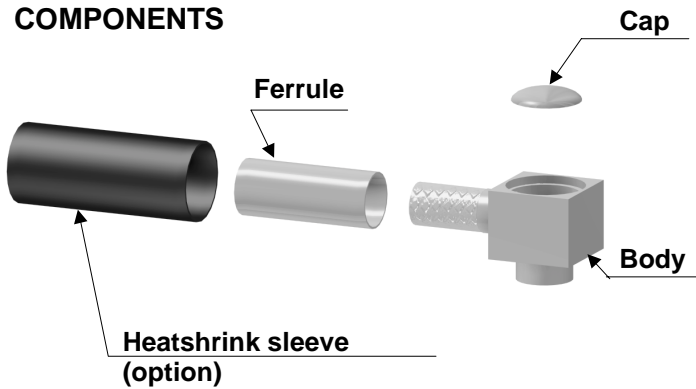


## STRIPPING DIMENSIONS

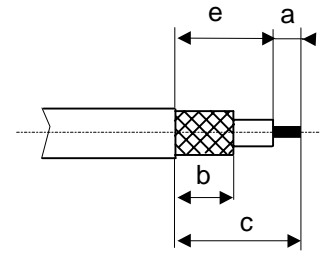


1

Slide the heatshrink sleeve onto the cable (Option).  
Slide the ferrule onto the cable.  
Strip the cable.

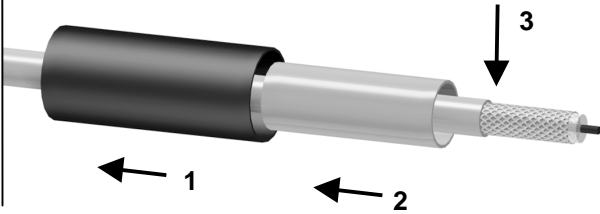


4

Crimp the ferrule with crimping tool ( see connector TDS ).  
Solder the inner conductor.

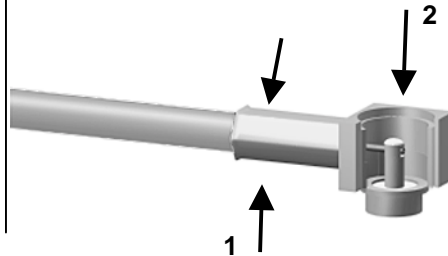


2

Fan the braid.

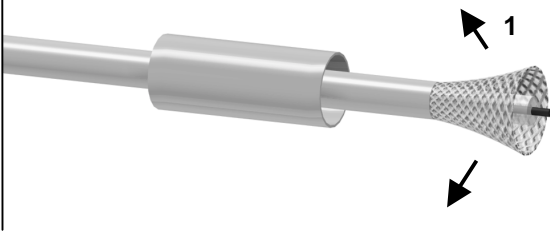


5

Place the cap into the body.

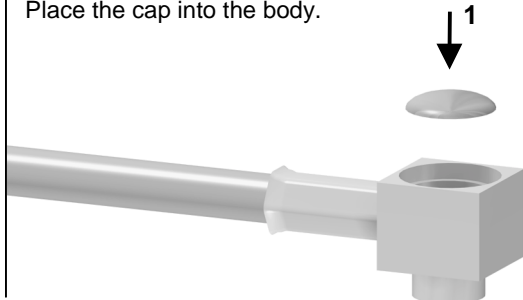

3

Push the connector body under the braid.  
Slide the ferrule over the braid.

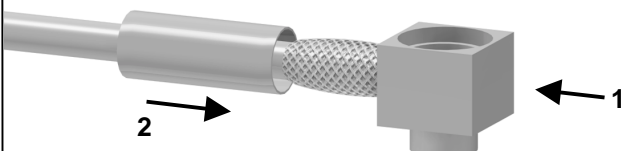

6

Press on the cap flush or slightly below the surface of the body assembly.  
Slide the sleeve over the ferrule and heatshrink it in place (Option).

