



- 1°) Slide ferrule on cable. Trim braid, dielectric and conductor to dimensions indicated.

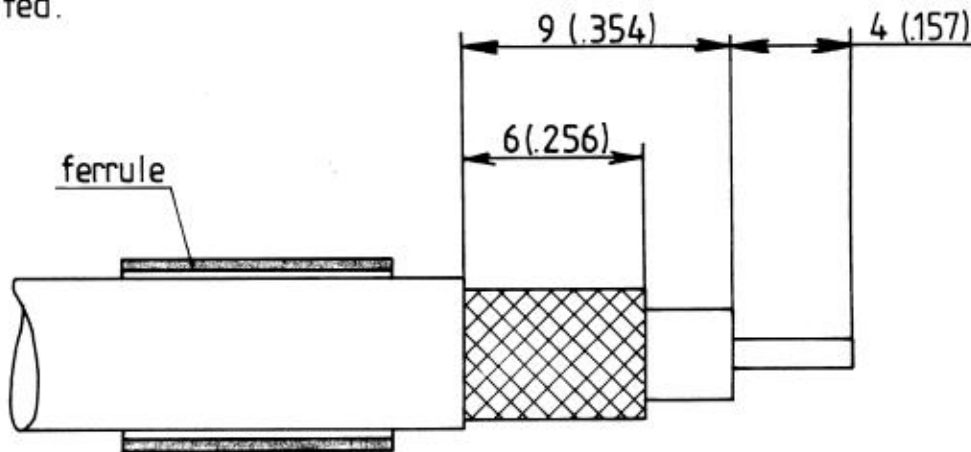


- 2°) Introduce conductor into centre contact, then crimp.  
Crimping tool: M 22520/2\_01 (Radiall 282 281) Selector position: 8  
positioner Radiall 282974

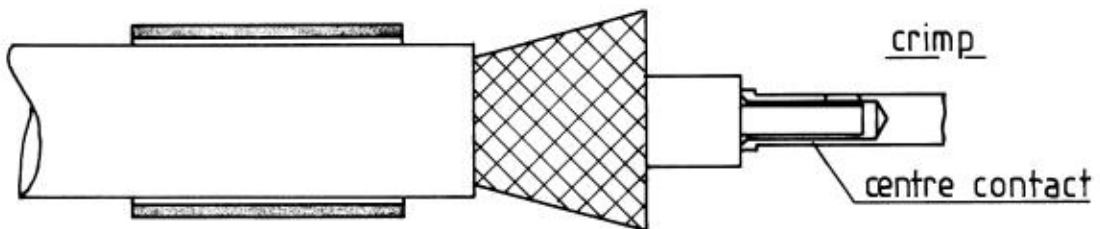

- 3°) Slide cable and contact into the body, ensuring that it's pushed home, and that the rear knurled barrel is under the braid. Slide the ferrule over the braid up to the body shoulder and crimp.

Crimping tool : M22520/5\_01 (Radiall 282 293)  
Die : M 22520/5\_05 (Radiall 282 246 ) Hex. B

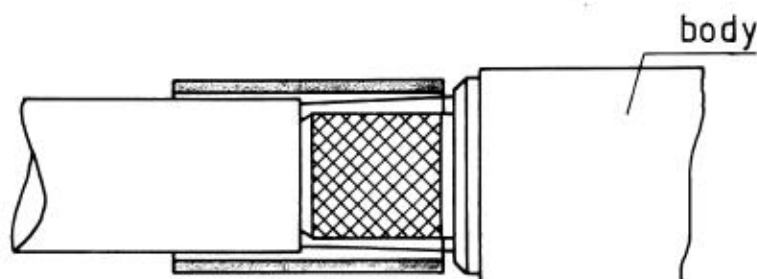

Dessiné le : 9.9.87  
par : faletti

PEN

Indice

M O D I F I C A T I O N S

Date  
Visé



101, rue Philibert Hoffmann  
Zone Industrielle Ouest  
93116 - ROSNY-SOUS-BOIS  
Téléphone : 854 - 80 - 40