RIGOH

Modification Bulletin

PAGE: 1/1

Model: Adonis-C1 Date			e: 23-Jan-0	1	No.: MA283006	
Modified Article: Printer Firmware History			Prepared by: S. Tomoe			
From: Technical Ser	rvices Dept., GTS Division					
Reason for	Parts catalog correction	U Vendo	or ch	ange	🗌 To n	neet standards
Modification:	lodification:		prove	ve reliability ()
	Part standardization	🛛 Other	-			

Printer firmware history for the Adonis-C1

Other Models

B3586080	Version	C. SUM	Production
А	1.88	03E4	1st Mass Prod.
В	1.92	D344	May Prod. '00
C	1.97	1769	November Prod. '00

Lanier Models

B3586081	Version	C. SUM	Production
А	1.88	03E4	1st Mass Prod.
В	1.92	D344	May Prod. '00
С	1.97	1769	November Prod. '00

Symptom Corrected	Other models	Lanier
After Danish has been set as the language, extra characters are printed out.	С	С
When the Dazel system is used, there is no job completion notification.	С	С
-With PortNavi, the job completion notification is either printed out but incorrect, or is not printed out at all. -Jobs performed without using registered user codes do not appear on the job history list.	С	С
This firmware has been modified to support Job MIB.	В	В
This version is DAZEL certified.	В	В
The position of the image is different when using the PCL driver vs. the PS driver.	В	В
The firmware has been modified to allow downloading of document formats.	В	В
This firmware has been modified to support Page Count MIB.	В	В
SC2001 sometimes occurs during a print job if Auto Tray Select has been selected.	В	В
SC365 sometimes occurs during a duplex print job.	В	В
A paper jam sometimes occurs after Auto Reset has been performed.	В	В
Any of the fonts that have been downloaded to the HDD can be set as the default font.	В	В

RIGOH

Technical Bulletin

Reissued: 08-Mar-01 Model: Adonis-C1

Date: 24-Jan-01

No.: RA283006a

RTB Correction

Subject: Printer Firmware History			Prepared by: S. Tomoe	
From: Technical	Services Dept., GTS Division			
Classification:	 Troubleshooting Mechanical Paper path 	Part informa Electrical Transmit/rec		 Action required Service manual revision Retrofit information
	Other ()			

Printer firmware history for the Adonis-C1.

Other Models

B3586080	Version	C. SUM	Production
A	1.88	03E4	1st Mass Prod.
В	1.92	D344	May Prod. '00
С	1.97	1769	November Prod. '00
D	1.98	576D	February Prod. '01

Lanier

B3586081	Version	C. SUM	Production
A	1.88	03E4	1st Mass Prod.
В	1.92	D344	May Prod. '00
С	1.97	1769	November Prod. '00
D	1.98	576D	February Prod. '01

Symptom Corrected	Other models	Lanier
When performing a mixed copy job with Letter and Legal paper, the machine does not switch between the trays from an AS400 system.	D	D
Grid lines do not appear on MS-Excel originals.	D	D
When printing from an SAP application, extra sheets of paper are fed.	D	D

Technical Bulletin

Reissued: 13-Feb-02

Model: Adonis-C1

RIGOH

Date: 24-Jan-01

No.: RA283006b

RTB Correction

The items in bold italics have been corrected or added.						
Subject: Printer Firmware History		Prepared by: S. Tomoe				
From: Technical Services Dept., GTS Division						
Classification:	Troubleshooting	Part informa	tion	Action required		
	Mechanical	Electrical		Service manual revision		
	Paper path	Transmit/rec	eive	Retrofit information		
	🛛 Other ()					

Printer firmware history for the Adonis-C1

For Models other than Lanier

B3586080	Version	C. SUM	Production
A	1.88	03E4	1st Mass Prod.
В	1.92	D344	May Prod. '00
С	1.97	1769	November Prod. '00
D	1.98	576D	February Prod. '01
E	2.01	BC8F	September Prod. '01

For Lanier Models

B3586081	Version	C. SUM	Production
A	1.88	03E4	1st Mass Prod.
В	1.92	D344	May Prod. '00
С	1.97	1769	November Prod. '00
D	1.98	576D	February Prod. '01
E	2.01	BC8F	September Prod. '01

Symptom Corrected	Other models	Lanier
SmartNetMonitor shows the wrong total counter value.	E	E
The right edge of the image is missing when printing out from an AS400 system.	E	E
Cannot perform auto conversion for A4/Letter.	E	E

Technical Bulletin

Reissued: 18-Feb-02

Model: Adonis-C1

Date: 24-Jan-01

No.: RA283006c

RTB Correction

The items in bold italics have been corrected or added.					
Subject: Printer Firmware History		Prepared by: S. Tomoe			
From: Technical :	Services Dept., GTS Division				
Classification:	Troubleshooting	Part informat	tion	Action required	
	Mechanical	Electrical		Service manual revision	
	Paper path	Transmit/rec	eive	Retrofit information	
	🛛 Other ()				

Printer firmware history for the Adonis-C1.

For Models Other than Lanier

B3586080	Version	C. SUM	Production
A	1.88	03E4	1st Mass Prod.
В	1.92	D344	May Prod. '00
С	1.97	1769	November Prod. '00
D	1.98	576D	February Prod. '01
E	2.01	BC8F	September Prod. '01
F	2.02	B89C	February Prod. '02

For Lanier Models

B3586081	Version	C. SUM	Production
А	1.88	03E4	1st Mass Prod.
В	1.92	D344	May Prod. '00
С	1.97	1769	November Prod. '00
D	1.98	576D	February Prod. '01
E	2.01	BC8F	September Prod. '01
F	2.02	B89C	February Prod. '02

Symptom Corrected	Other models	Lanier
After NIB reset has been performed, "NIB Initializing" is sometimes displayed, and the machine does not enter stand-by mode.	F	F
When using the Smart Net Monitor, sometimes nothing is printed out.	F	F
When printing two pages from a UNIX system, a blank page may be inserted in between.	F	F

RIGOH

Technical Bulletin

Reissued: 1-Jul-03 Model: Adonis-C1

Date: 24-Jan-01

No.: RA283006d

RTB Correction

Subject: Printer F	Firmware History		Prepare	d by: S. Tomoe
From: 1st Tech. S	Support Sec. Service Support	Dept.		
Classification:	 Troubleshooting Mechanical Paper path Other () 	Part informat Electrical Transmit/rec		 Action required Service manual revision Retrofit information

Printer firmware history for the Adonis-C1.

(For Other Models)

B3586080	Version	C. SUM	Production
А	1.88	03E4	1st Mass Prod.
В	1.92	D344	May Prod. '00
С	1.97	1769	November Prod. '00
D	1.98	576D	February Prod. '01
E	2.01	BC8F	September Prod. '01
F	2.02	B89C	February Prod. '02
G	2.03	2E14	March Prod. '02
Н	2.05	5112	May Prod. '02

(For Lanier Models)

B3586081	Version	C. SUM	Production
А	1.88	03E4	1st Mass Prod.
В	1.92	D344	May Prod. '00
С	1.97	1769	November Prod. '00
D	1.98	576D	February Prod. '01
E	2.01	BC8F	September Prod. '01
F	2.02	B89C	February Prod. '02
G	2.03	2E14	March prod. '02
Н	2.05	5112	May Prod. '02

Reissued: 1-Jul-03

Technical Bulletin

PAGE: 2/2

Model: Adonis-C1

Date: 24-Jan-01

No.: RA283006d

Symptom Corrected	Other models	Lanier
All characters from Euro symbol sets are printed out in Arial regardless of the font selected (except for Times New Roman).	Н	Н
Added Euro symbol sets (containing the Euro currency symbol) to match the capability of HP printers (PCL5e, PCLXL).	G	G
A PS job is deleted when the Bypass tray is selected as the default tray in the PS driver.	G	G
After NIB reset has been performed, "NIB Initializing" is sometimes displayed, and the machine does not enter stand-by mode.	F	F
When using the Smart Net Monitor, sometimes nothing is printed out.	F	F
When printing two pages from a UNIX system, a blank page may be inserted in between.	F	F
SmartNetMonitor shows wrong total counter value.	E	E
The right edge of the image is missing when printing out from the AS400.	E	E
Cannot perform auto conversion for A4/Letter.	E	E
When performing a mixed copy job with Letter and Legal, the machine does not switch between the trays from an AS400 system.	D	D
Grid lines do not appear on MS-Excel originals.	D	D
When printing from an SAP application, extra sheets of paper are fed.	D	D
After Danish has been set as the language, extra characters are printed out.	С	С
When the Dazel system is used, there is no job completion notification.	С	С
-With PortNavi, the job completion notification is either printed out but incorrect, or is not printed out at all. -Jobs performed without using registered user codes do not appear on the job history list.	С	С
This firmware has been modified to support Job MIB.	В	В
This version is DAZEL certified.	В	В
The position of the image is different when using the PCL driver vs. the PS driver.	В	В
The firmware has been modified to allow downloading of document formats.	В	В
This firmware has been modified to support Page Count MIB.	В	В
SC2001 sometimes occurs during a print job if Auto Tray Select has been selected.	В	В
SC365 sometimes occurs during a duplex print job.	В	В
A paper jam sometimes occurs after Auto Reset has been performed.	В	В
Any of the fonts that have been downloaded to the HDD can be set as the default font.	В	В