

Model: Mojito		Date: 10-Jun-02	No.: RA293025
Subject: Printer Controller (G594) System Firmware History		Prepared by: S.Orita	
From: Technical Services sec. Service Planning Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input checked="" type="checkbox"/> Other (Information)		

Modification history of the Printer Controller EB-70 (G594) system firmware.

Firmware Modification History

1. System firmware version: 1.0.0

Patch File	Issue(s)
1-1TIC8	SC occurs with high volume documentation printing.
1-1OQ5	<ol style="list-style-type: none"> Delays in RIP time when using the RIP and Hold option in Command Workstation (CWS). Problems using Websetup with Windows 2000 or Windows ME. Not possible to use the Cancel Print option in CWS with specific files.

2. System firmware version: 1.0.1

Note: This version includes the patch (1-1TIC8 and 1-1OQ5) for Version 1.0.0 and it was released as Version 1.01.

Patch File	Issue(s)
1-2NCA5	If memory increases to 128MB with the STE board, performance speed becomes slower than with 64MB of memory. SC occurs with high volume documentation printing.
1-2173X	"ricohEngSerialNumber" for Ricoh Private MIB not supported.
1-2MK1K	PCL5/300dpi: Print image is not correct after storing at the Document Server.
1-4YE69	When PS data with Booklet imposition is sent continuously, the job is cancelled.