

Model: Phoenix II (Eagle II/Falcon II)		Date: 31-Jul-98	No: 6
Subject: Software Information		Prepared by: M.Kitajima	
From: QAC Field Information Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input checked="" type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Other ()		

The bulletin is to inform you of the modifications applied to the main ROM.

- ROM Part Number

OLD	NEW
A2045107C	A2045120

Energy Star

A. Auto Energy Saver Time Setting (SP5-102)

The range of possible values for the Auto Energy Saver timer has been changed from "1 to 120 minutes" to "1 to 240 minutes".

B Auto Shut Off Time Setting (SP5-305-001)

The range of possible values for the Auto Shut Off timer has been changed from "1 to 120 minutes" to "1 to 240 minutes".

C Auto Shut Off Selection (SP5-305-002)

0:Yes 1:No
 Default = 0 (NA) Default = (Others)

This mode has been added to UP mode No.33.

For the cut-in serial number, refer to the MBs (Eagle II:15, Falcon II:18) that will be issued on 31 July, 1998.

- ROM Part Number

OLD	NEW
A2045120	A2045120A

1 No paper feed jam at the duplex copy

The start speed of the transport motor has been corrected for when the paper is fed from the duplex tray.

If the pressure of the bottom plate is insufficient due to the unstable start speed of the transport motor, the paper in the duplex tray may not be fed.

2 SC721 when setting up the CS130

To prevent SC721 from appearing when setting up the CS130, the detection time for SC721 has been changed from 300 ms. to 400 ms.

For the cut-in serial numbers, see the attached.

Model: Phoenix II (Eagle II/Falcon II)	Date: 31-Jul-98	No: 6
--	-----------------	-------

- ROM Part Number
 - OLD • NEW
 - A2045120A A204521

The following problem has been corrected.

Problem

If the power is turned on when the front cover is open, the front cover is then closed and the start key is pressed, SC440 occurs.

Cause

Due to the change to the inner circuit of the main motor to improve the reliability of the motor, the current software cannot recognize this modified motor correctly, resulting in the SC440 display.

For the cut- in serial number, refer to the MBs (Eagle II:16, Falcon II:19) that will be issued on 31 July, 1998.

Model: Phoenix II (Eagle II/Falcon II)	Date: 31-Jul-98	No: 6
--	-----------------	-------

MODEL NAME	V/Hz	DESTINATION	JAPAN PRODUCTION	
			CODE	SERIAL NUMBER
Gestetner 2740Z nashuatec 3740 Savin 9400	115/60	USA, Canada, L. America	A204- 10	AK47090001
Savin 9400	115/60	USA, Canada	A204- 15	8A37080001
Ricoh FT5640	115/60	USA, Canada	A204- 17	A744712xxxx
Ricoh FT5640	110/60	Taiwan, Saudi	A204- 19	A7447090001
Gestetner 2740Z nashuatec 3740 Rex Rotary 8740Z	220. 230, 240/50	Europe, etc.	A204- 22	AL17090001
Infotec 5403Z	220. 230, 240/50	Europe	A204- 26	3N51170001
Ricoh FT5640	220. 230, 240/50	Europe	A204- 27	A7447090091
Ricoh FT5640	220/50	Asia, Middle East	A204- 29	A7447080043
Gestetner 2740z	110/60	Taiwan	A204- 50	A047080001
Ricoh FT5640	220/50	China	A204- 69	A7447080118
Gestetner 2740ZT nashuatec 3740T Savin 9400L	115/60	USA, Canada, L. America	A206- 10	AK3712xxxx
Savin 9400L	115/60	USA, Canada	A206- 15	8A4712xxxx
Ricoh FT5740	115/60	USA, Canada,	A206- 17	A745712xxxx
Ricoh FT5740	110/60	Taiwan, Saudi	A206- 19	A745712xxxx
Gestetner 2740ZT nashuatec 3740T Rex Rotary 8740ZT	220, 230, 240/50	Europe, etc.	A206- 22	AL2712xxxx
Infotec 5403ZT	220, 230, 240/ 50	Europe	A206- 26	3N7127xxxx
Ricoh FT5740	220, 230, 240/ 50	Europe	A206- 27	A745712xxxx
Ricoh FT5740	220/50	Asia, Middle East	A206 -29	A745712xxxx
Gestetner 2740ZTD nashuatec 3740TD Savin 9400D	115/ 60	USA, Canada, L. America	A207- 10	AK27080001
Savin 9400D	115/ 60	USA, Canada	A207- 15	8A57080001
Ricoh FT5840	115/ 60 115/ 60	USA, Canada	A207- 17	A7467080001
Ricoh FT5840	110/ 60	Taiwan, Saudi	A207- 19	A7467090278
Gestetner 2740ZTD nashuatec 3740TD Rex Rotary 8740ZTD	220, 230, 240/ 50	Europe, etc.	A207 -22	AL37080001
Infotec 5403DZ	220, 230, 240/ 50	Europe	A207- 26	3N61070001
Ricoh FT5840	220, 230, 240/ 50	Europe	A207- 27	A7467080499
Ricoh FT5840	220/ 50	Asia, Middle East	A207- 29	A7467080563
Ricoh FT5840	220/50	China	A207- 69	A7467080646

Model: Phoenix II (Eagle II/Falcon II)

Date: 31-Jul-98

No: 6

MODEL NAME	V/ Hz	DESTINATION	RPL PRODUCTION	
			CODE	SERIAL NUMBER
Gestetner 2740Z nashuatec 3740 Rex Rotary 8740Z	220,230, 240/ 50	Europe, etc.	A204- 52	AL17300001
Infotec 5403Z	220,230, 240/ 50	Europe	A204- 56	3N53070001
Ricoh FT5640	220,230, 240/ 50	Europe	A204- 57	A744730047
Gestetner 2740ZT nashuatec 3740T Rex Rotary 8740ZT	220,230, 240/ 50	Europe, etc.	A206- 52	AL2732xxxx
Infotec 5403ZL	220,230, 240/ 50	Europe	A206- 56	3N73070001
Ricoh FT5740	220,230, 240/ 50	Europe	A206- 57	A7457310001
Gestetner 2740ZTD nashuatec 3740TD Rex Rotary 8740ZTD	220,230, 240/ 50	Europe, etc.	A207- 52	AL37300001
Infotec 5403DZ	220,230, 240/ 50	Europe	A207- 56	3N63070001
Ricoh FT5840	220,230, 240/ 50	Europe	A207- 57	A7467310001

Model: Phoenix II (Eagle II/Falcon II)	Date: 31-Jul-98	No: 6
--	-----------------	-------

			RAI PRODUCTION	
MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NUMBER
Gestetner 2732Z nashuatec 3732 Savin 9032	115/60	USA, Canada, L. America	A208-10	AK77890001
Savin 9032	115/60	USA, Canada	A208-15	8A67890001
Ricoh FT5632	115/60	USA, Canada	A208-17	A7477880292
Ricoh FT5632	110/60	Taiwan Saudi	A208-19	A7477890372
Gestetner 2732Z nashuatec 3732 Rex-Rotay 9732Z	220, 230, 240/50	Europe, etc.	A208-22	AL47890001
Infotec 5321Z	220, 230, 240/50	Europe	A208-26	3N28970001
Ricoh FT5632	220, 230, 240/50	Europe	A208-27	A747790001
Ricoh FT5632	220/50	Asia, Middle East	A208-29	A7477900739
Ricoh FT5632	220,230, 240/50,60	Asia	A208-39	A7477890241
Gestetner 2732Z	110/60	Taiwan	A208-50	A067890001
Gestetner 2732Z	220/50	China	A208-62	AP67890001
Ricoh FT5632	110/60	China	A208-63	A747792xxxx
Ricoh FT5632	220/50	China	A208-69	A7477880975
Gestetner 2732ZT nashuatec 3732T Savin 9032L	115/60	USA, Canada, L. America	A210-10	AK6792xxxx
Savin 9032L	115/60	USA, Canada	A210-15	8A7792xxxx
Ricoh FT5732	115/60	USA, Canada	A210-17	A748792xxxx
Ricoh FT5732	110/60	Taiwan, Saudi	A210-19	A748792xxxx
Gestetner 2732ZT nashuatec 3732T Rex Rotary 8232ZT	220, 230, 240/50	Europe, etc.	A210-22	AL5792xxxx
Infotec 5321ZL	220, 230, 240/50	Europe	A210-26	3N48970001
Ricoh FT5732	220, 230, 240/50	Europe	A210-27	A748792xxxx
Ricoh FT5732	220/50	Asia, Middle East	A210-29	A7487890001

Model: Phoenix II (Eagle II/Falcon II)	Date: 31-Jul-98	No: 6
--	-----------------	-------

			RAI PRODUCTION	
MODEL NAME	V/Hz	DESTINATION	CODE	SERIAL NUMBER
Gestetner 2732ZTD nashuatec 3732TD Savin 9032	115/60	USA, Canada, L. America	A211-10	AK57890001
Savin 9032	115/60	USA, Canada	A211-15	8A87900001
Ricoh FT5832	115/60	USA, Canada	A211-17	A7497881017
Ricoh FT5832	110/60	Taiwan Saudi	A211-19	A7497890810
Gestetner 2732ZTD nashuatec 3732TD Rex-Rotary 9732TD	220, 230, 240/50	Europe, etc.	A211-22	AL67890001
Infotec 5321DZ	220, 230, 240/50	Europe	A211-26	3N38970001
Ricoh FT5832	220, 230, 240/50	Europe	A211-27	A7497890001
Ricoh FT5832	220/50	Asia, Middle East	A211-29	A7497890840
Ricoh FT5832	220,230, 240/50,60	Asia	A211-39	A7497900751
Gestetner 2732ZTD	220/50	Chaina	A211-62	AP58840001
Ricoh FT5832	220/50	China	A211-63	A749887xxxx
Ricoh FT5832	220/50	China	A211-69	A7497890860