

Model: Bellini			Date: 25-Apr-03		03	No.: RA294061
Subject: Service Parts of Punch Heads				Prepared by: S. Orita		
From: 2nd Tech Support Sec. Service Support Dept.						
Classification:	□ Troubleshooting	☐ Part inf	ormat	ion		
	☐ Mechanical	☐ Electric	al		☐ Service	ce manual revision
	☐ Paper path	☐ Transm	ransmit/receiv		☐ Retrofit information	
	Other ()					

The following punch heads have been registered as service parts for replacement in the field, so that the entire punch unit does not have to be replaced when the punch heads fail:

P/N A8129501 (Punch Head – 8 mm) --- North America Version P/N A8129502 (Punch Head - 6.5mm) --- European Version

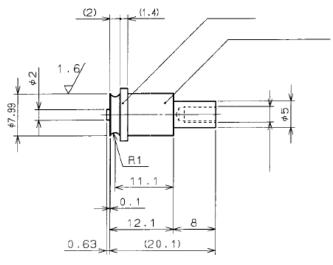

P/N A8129501

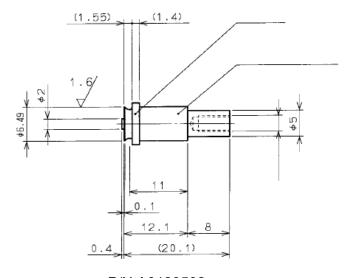

P/N A8129502

PAGE: 2/4

Model: Bellini Date: 25-Apr-03 No.: RA294061

Note:


1. To ensure a smoother punch head/receiver operation, the service part punch head is smaller than that fitted in new production machines. This creates a better match between the two, as both experience gradual wear during the course of operation.

Visual distinction: Service part punch head is gold (Production head is silver.)


- 2. If the problem persists even after replacing the punch head, we recommend replacing the entire punch unit.
- 3. The punch heads can only be supplied as service parts for the Bellini-C1, because for other models such as the B-C2, additional precise adjustments are required.

Punch Head Replacement Procedure

1. Remove the upper and lower guides (4 screws).

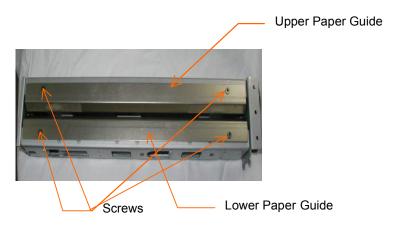

- 2. Rotate the drive gear until the punch head and punch head receiver are aligned.
- 3. Remove the punch head, holding the head with a pair of needle-nosed pliers (1 screw per head).

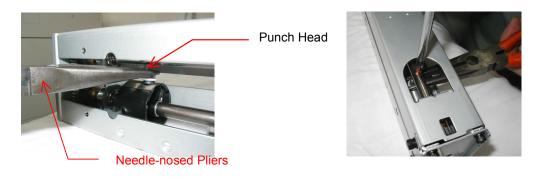


NOTE: a. Do not touch the punch head with bare hands.

b. Do not remove any other screws.


PAGE: 3/4

Model: Bellini Date: 25-Apr-03 No.: RA294061




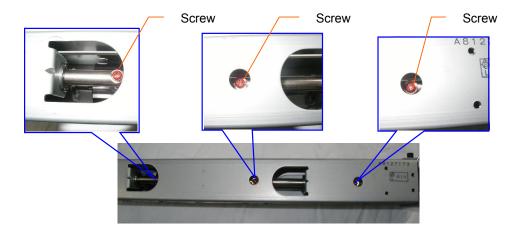

4. Insert the new punch head.

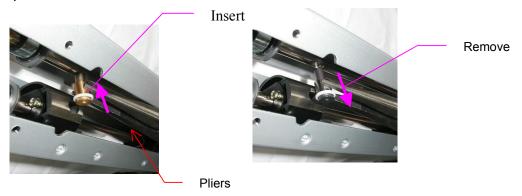

5. Secure the new punch head in place, holding it with a pair of needle-nosed pliers (1 screw).

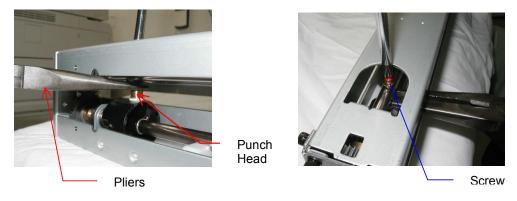

NOTE: a. Do not touch the punch head with bare hands.

- b. Make sure to attach the head perpendicular (90 degrees) to the shaft.
- c. Do not remove any other screws.




Model: Bellini

Technical Bulletin

Date: 25-Apr-03 No.: RA294061

PAGE: 4/4

- 6. Reinstall the paper guides (4 screws).
- 7. Rotate the drive gear manually and confirm that the punch head/receiver mechanism functions smoothly (that the two are properly aligned with one another).

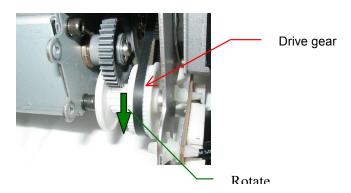

Note: Do not forcibly rotate the gear. If it is difficult to rotate, replace the entire punch unit.