

Reissued: 26-May-00

Model: Stinger-C1	Date: 31-Dec-99	No.: RA250015a
-------------------	-----------------	----------------

## RTB Correction

The items in bold italics have been corrected or added.

Subject: ROM History (Stinger-C PostScript Option)		Prepared by: K. Miura	
From: Technical Services Dept., GTS Division			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input checked="" type="checkbox"/> Retrofit information
	<input type="checkbox"/> Other ( )		

Firmware history for the Stinger-C PostScript Option

Lanier Model

B3085283	File No. (B308Lxxx)	Version	Production
A	001	1.2.0	1st Mass Prod.

Other Models

B3085280	File No. (B308oxxx)	Version	Production
A	001	1.0.0	1st Mass Prod.
B	002	1.2.0	October Prod. '99
C	003	1.2.1	October Prod. '99
D	004	1.2.2	<b>January Prod. '00</b>

Symptom Corrected	Lanier	Other
The product names of the Stinger-C Postscript drivers for NRG, Savin and Infotec should be corrected as follows: <b>Incorrect:</b> NRG D415s/2815s/3215s PS3 Savin 9915DP PS3 infotec PS3 <b>correct:</b> NRG D415s/2815S/3215 PS3 Savin 2015DP PS3 infotec 4150 MF PS3	-	<b>D</b>
The PostScript Option firmware has been modified so that it can also be used with the Stinger-C1L.	-	<b>C</b>
The PostScript Option firmware has been modified so that it can also be used with the Russian-C.	<b>A</b>	<b>B</b>
The printer controller can now detect whether it is installed in a Stinger-C1 or Stinger-C1L.		<b>A</b>

Reissued: 25-Oct-00

Model: Stinger-C1	Date: 31-Dec-99	No.: RA250015b
-------------------	-----------------	----------------

## RTB Correction

The items in bold italics have been corrected or added.

Subject: ROM History (Stinger-C PostScript Option)		Prepared by: K. Miura	
From: Technical Services Dept., GTS Division			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input checked="" type="checkbox"/> Retrofit information
	<input type="checkbox"/> Other (      )		

Firmware history for the Stinger-C PostScript Option

Lanier Model

B3085283	File No. (B308Lxxx)	Version	Production
A	001	1.2.0	1st Mass Prod.

Others

B3085280	File No. (B308oxxx)	Version	Production
A	001	1.0.0	1st Mass Prod.
B	002	1.2.0	October Prod. '99
C	003	1.2.1	October Prod. '99
D	004	1.2.2	January Prod. '00
<b><i>E</i></b>	<b><i>005</i></b>	<b><i>1.2.4</i></b>	<b><i>November Prod. '00</i></b>

Reissued: 25-Oct-00

Model: Stinger-C1	Date: 31-Dec-99	No.: RA250015b
-------------------	-----------------	----------------

Symptom Corrected	Lanier	Other								
<p><b>The print speed slows down during continuous printing of a 1-page job.</b>  <b>** To activate this correction, it is necessary to set Bit SW3, bit 2 to <u>1</u> (0=Disabled, 1=Enabled) and SET BIT SW3, bit 4 to <u>1</u> (DAZEL support function disabled). The correction will not be effective if both of these switches are enabled.</b></p>	-	<b>E</b>								
<p><b>Firmware modified so that the controller can connect to and be used with the DAZEL System. However, the Russian-C is not yet officially certified by DAZEL Corp.</b>  <b>When you enable this function, it is necessary to do the following:</b>  <b>-Upgrade the NIB firmware to version 4.0.6 or later and the PS3 firmware to version 1.2.4 or later.</b>  <b>-Set the NIC to bi-directional-mode (refer to the NIC manual).</b>  <b>-Do not set Bit SW3, bit 2 to 1 (as explained above, these two SW should not be simultaneously enabled).</b></p> <p><b>To deactivate the DAZEL support function, set Bit SW3, bit 4 to <u>1</u> (0=Enabled, 1=Disabled).</b></p>	-	<b>E</b>								
<p>The product names of the Stinger-C Postscript drivers for NRG, Savin and Infotec should be corrected as follows:</p> <table style="width: 100%; border: none;"> <tr> <td style="text-align: center;"><b>Incorrect:</b></td> <td style="text-align: center;"><b>Correct:</b></td> </tr> <tr> <td>NRG D415s/2815s/3215s PS3</td> <td>NRG D415s/2815S/3215 PS3</td> </tr> <tr> <td>SAVIN 9915DP PS3</td> <td>SAVIN 2015DP PS3</td> </tr> <tr> <td>infotec PS3</td> <td>infotec 4150 MF PS3</td> </tr> </table>	<b>Incorrect:</b>	<b>Correct:</b>	NRG D415s/2815s/3215s PS3	NRG D415s/2815S/3215 PS3	SAVIN 9915DP PS3	SAVIN 2015DP PS3	infotec PS3	infotec 4150 MF PS3	-	D
<b>Incorrect:</b>	<b>Correct:</b>									
NRG D415s/2815s/3215s PS3	NRG D415s/2815S/3215 PS3									
SAVIN 9915DP PS3	SAVIN 2015DP PS3									
infotec PS3	infotec 4150 MF PS3									
<p>The PostScript Option firmware has been modified so that it can also be used with the Stinger-C1L.</p>	-	C								
<p>The PostScript Option firmware has been modified so that it can also be used with the Russian-C.</p>	A	B								
<p>The printer controller can now detect whether it is installed in a Stinger-C1 or Stinger-C1L.</p>		A								

Reissued: 01-Mar-01

Model: Stinger-C1	Date: 31-Dec-99	No.: RA250015c
-------------------	-----------------	----------------

## RTB Correction

The items in bold italics have been corrected or added.

Subject: ROM History (Stinger-C PostScript Option)		Prepared by: K. Miura	
From: Technical Services Dept., GTS Division			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input checked="" type="checkbox"/> Retrofit information
	<input type="checkbox"/> Other (      )		

Firmware history for the Stinger-C PostScript Option.

### Lanier Model

B3085283	File No. (B308Lxxx)	Version	Production
A	001	1.2.0	1st Mass Prod.

### Other Models

B3085280	File No. (B308oxxx)	Version	Production
A	001	1.0.0	1st Mass Prod.
B	002	1.2.0	October Prod. '99
C	003	1.2.1	October Prod. '99
D	004	1.2.2	January Prod. '00
E	005	1.2.4	November Prod. '00
<b><i>F</i></b>	<b><i>006</i></b>	<b><i>1.2.6</i></b>	<b><i>January Prod. '01</i></b>

Symptom Corrected (current modifications only; for older ones, see earlier bulletins)	Lanier	Other
<b><i>During RAM collation printing, the job cannot be cancelled.</i></b>	—	<b><i>F</i></b>
<b><i>When a job is cancelled, the output paper count is sent to the printer controller (a side-effect of the previous modification made for DAZEL connection).</i></b>	—	<b><i>F</i></b>

Reissued: 7-May-02

Model: Stinger-C1	Date: 31-Dec-99	No.: RA250015d
-------------------	-----------------	----------------

## RTB Correction

The items in bold italics have been corrected or added.

Subject: ROM History (Stinger-C PostScript Option)		Prepared by: K. Miura	
From: Technical Services sec. Service Planning Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input checked="" type="checkbox"/> Retrofit information
	<input type="checkbox"/> Other (      )		

Firmware history for the Stinger-C PostScript Option.

For the Lanier Model

B3085283	File No. (B308Lxxx)	Version	Production
A	001	1.2.0	1st Mass Prod.

For Other Models

B3085280	File No. (B308oxxx)	Version	Production
A	001	1.0.0	1st Mass Prod.
B	002	1.2.0	October Prod. '99
C	003	1.2.1	October Prod. '99
D	004	1.2.2	January Prod. '00
E	005	1.2.4	November Prod. '00
F	006	1.2.6	January Prod. '01
<b>G</b>	<b>007</b>	<b>1.2.7</b>	<b>December Prod. '01</b>
<b>H</b>	<b>008</b>	<b>1.2.8</b>	<b>May Prod. '02</b>

Symptoms Corrected	Lanier	Other
<i>Software modified so that it is possible to perform jobs containing a mixture of PCL and PS commands when printing directly from a host application.</i>	-	<b>H</b>
<i>If the machine does not contain the driver paper size when printing the 1st set of a Collate job, and Job Reset is then performed, the "Resetting Job..." display does not clear.</i>	-	<b>G</b>
<i>Software modified to ignore a "DD" tag in the print data, preventing an undefined error and allowing the job to go through.</i>	-	<b>G</b>