
#### Modification Bulletin

| Model: Martini-C1 LCT (RT43) / B4/LG Kit / A3/DLT Kit Dat |                          |        |                       | e: 9-Jan-03 |        | No.: MB473001  |
|---|--------------------------|--------|-----------------------|-------------|--------|----------------|
| Modified Article: C                                       | ase Seal                 |        | Prepared by: K. Miura |             |        |                |
| From: Technical Ser                                       |                          |        |                       |             |        |                |
| Reason for  | Parts catalog correction | U Venc | lor ch                | ange        | 🗌 To n | neet standards |
| Modification:   |                          |        | /e reliability ( )    |             | )      |                |
| Part standardization Other                                |                          |        |                       |             |        |                |

The following has been added to ensure that the wire shown below does not come out of position, which can occur when the A3/DLT kit is forcibly closed while there is slack in the wire (see the next page for the attachment position).

| Old part<br>number | New part<br>number | Description | Q'ty | Int | Page | Index | Note |
|--------------------|--------------------|-------------|------|-----|------|-------|------|
|                    | AA152441           | Case Seal   | 1    |     | 19   | 25    |      |

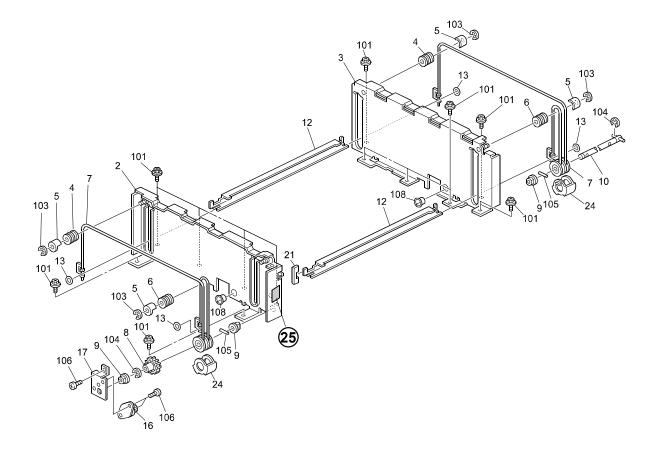




Model: Martini-C1 LCT (RT43) / B4/LG Kit / A3/DLT Kit Date: 9-Jan-03 No.: MB473001

#### In the Field:

Please add the Case Seal as follows:

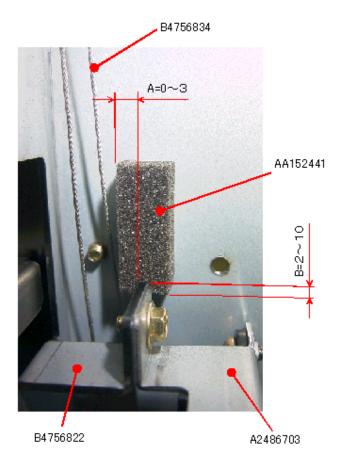


## Modification Bulletin

| Model: Martini-C1 LCT (RT43) Date                    |                          |                       |                   | e: 23-Jan-03 |        | No.: MB473002  |  |
|--|--------------------------|-----------------------|-------------------|--------------|--------|----------------|--|
| Modified Article: T                                  | ightner Bracket Screw    | Prepared by: K. Miura |                   |              |        |                |  |
| From: Technical Services Sec. Service Planning Dept. |                          |                       |                   |              |        |                |  |
| Reason for   | Parts catalog correction | U Vend                | lor ch            | ange         | 🗌 To n | neet standards |  |
| Modification:  |                          |                       | e reliability ( ) |              | )      |                |  |
|  | Part standardization     | Othe                  | r                 |              |        |                |  |

To prevent the teeth of the paper feed timing belt (AA043944) from skipping, the fixing screw for the tightener bracket has been changed:

| Old part<br>number | New part<br>number | Description                      | Q'ty | Int | Page | Index | Note |
|--------------------|--------------------|----------------------------------|------|-----|------|-------|------|
| 04514008B-         |                    | Philips Tapping Screw - M4x8     |      |     | 13   | 106   |      |
|                    | ►09514008B         | Philips Screw With Washer - M4x8 |      | X/O | 13   | 110   |      |

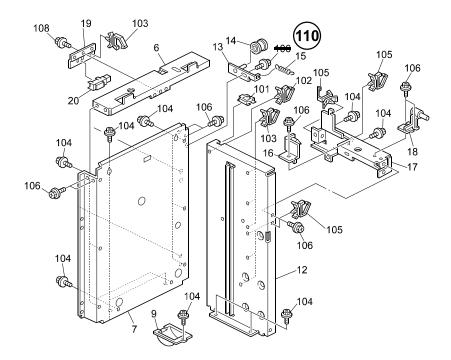

|         | Draduation 1 |
|---------|--------------|
| (Japan) | Production ] |

| MODEL NAME | V/Hz           | DESTINATION  | CODE    | SERIAL NO.  |
|------------|----------------|--------------|---------|-------------|
| RT43       | 120/60         | USA          | B473-17 | J44301xxxxx |
| RT43       | 220-240/50, 60 | Europe, etc. | B473-26 | 8P21020001  |
| RT43       | 220-240/50, 60 | Europe, etc. | B473-27 | J4420900059 |

## Modification Bulletin

| Model: Martini-C1 LCT (RT43) Date |   |        | e: 28-Aug-03 |   | No.: MB473003 |                     |
|-----------------------------------|---|--------|--------------|---|---------------|---------------------|
| Modified Article: S               | Prepared by: Y.Urushihara   |        |              |   |               |                     |
| From: 1st Tech. Sup               |   |        |              |   |               |                     |
| Reason for<br>Modification:       | Parts catalog correction Uendor ch   To facilitate assembly To improv |        |              | • | □ To n<br>(   | neet standards<br>) |
|                                   | Part standardization  | C Othe | r            |   |               |                     |

The following have been changed due to parts standardization.

| Old part | New part | Description                | Q'ty | Int | Page | Index | Note |
|----------|----------|----------------------------|------|-----|------|-------|------|
| number   | number   |                            |      |     |      |       |      |
| B4735110 | B4735130 | Main Control Board         | 1-1  | X/O | 11   | 14    |      |
| B4735150 | B4735151 | IC – UVEPROM 512K X8 120NS | 1-1  | X/O | 21   | 1     |      |

#### [RCL (Japan) Production ]

| MODEL NAME | V/Hz           | DESTINATION  | CODE    | SERIAL NO.  |
|------------|----------------|--------------|---------|-------------|
| RT43       | 120/60         | USA          | B473-17 | J44308xxxxx |
| RT43       | 220-240/50, 60 | Europe, etc. | B473-26 | 8P20830001  |
| RT43       | 220-240/50, 60 | Europe, etc. | B473-27 | J4430700378 |

## Modification Bulletin

| Model: Martini-C1 LCT (RT43) Date |  |  | e: 28-Aug-03 |             | No.: MB473004       |  |
|-----------------------------------|--|--|--------------|-------------|---------------------|--|
| Modified Article: F               | Prepared by: Y.Urushihara                |  |              |             |                     |  |
| From: 1st Tech. Sup               |  |  |              |             |                     |  |
| Reason for<br>Modification:       | n for Parts catalog correction Vendor ch |  | 0            | ☐ To n<br>( | neet standards<br>) |  |

The following have been changed due to parts standardization.

| Old part | New part | Description             | Q'ty | Int | Page | Index | Note |
|----------|----------|-------------------------|------|-----|------|-------|------|
| number   | number   |                         |      |     |      |       |      |
| B4731201 | B4731203 | Cover – Misfeed Removal | 1-1  | X/O | 3    | 23    |      |
| AF031064 | AF031081 | Feed Roller             | 1-1  | X/O | 5    | 20    |      |
| AF030050 | AF030080 | Pick-up Roller          | 1-1  | X/O | 5    | 24    |      |
| AF032050 | AF032080 | Separation Roller       | 1-1  | X/O | 7    | 18    |      |

#### [RCL (Japan) Production ]

| MODEL NAME | V/Hz           | DESTINATION  | CODE    | SERIAL NO.  |
|------------|----------------|--------------|---------|-------------|
| RT43       | 120/60         | USA          | B473-17 | J44308xxxxx |
| RT43       | 220-240/50, 60 | Europe, etc. | B473-26 | 8P20830001  |
| RT43       | 220-240/50, 60 | Europe, etc. | B473-27 | J4430800001 |