

Model: Penguin		Date: 30-Apr-99	No.: RA246006
Subject: Installation of ST29 for the Penguin (Little: 50 cpm)		Prepared by: F. Noguchi	
From: Technical Service Dept., GTS Division			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input checked="" type="checkbox"/> Other ()		

To enable the installation of the ST29 sorter stapler on the Penguin (Little: 50 cpm), the following items have been changed from the June 1998 production runs.

Note: For the units manufactured in May 1998 and earlier, please add the film and install the modified ROM.

1. With some types of recycled paper, jams may occur in the bin's end fence. To prevent this, film (A8342145) has been attached to the anti-static brush as shown.
2. When the duplex sorter enable by-pass mode is selected with SP mode, the jogger will be moved even when feeding small size (A5, HLT, B6 Lengthwise) paper and the jogger may crash into the bin. To prevent this, the software has been changed so that the jogger will not be moved for small paper sizes. (ROM A6585103B → C)

Cut-in Serial Numbers

(from June '98 production)

- A658 -15: 8A98060001~
- 17: A7508060001~
- 22: AL88060001~
- 26: 3N90680001~

Parts Catalog Page 6

