



SERVICE BULLETIN

PRODUCT: Computer Monitor
BULLETIN: MON00-002
MODEL: CSM920BT

SUBJECT: Decrease the Failure Rate of IC601

BACKGROUND: Do to a surge created in IC601 from the sync-input signal on PIN # 5, internal diode D3 e-b shorts.

SOLUTION: Change D606 from switching diode (1n4148) to a zener diode (UZ3.3BSA).

PARTS LIST: See Below

ORIGINAL			NEW	
Location No.	Part No.	Description	Part No.	Description
D606	0401-000005	Switching 1N4148,75V 200ma	0403-001131	Zener UZ3.3BSA, 3.16 - 3.38V, 500

Disclaimer: This information is provided "as is" without warranty of any kind either expressed or implied, including, but not limited to, the implied warranties of merchantability and fitness for a particular purpose.