



SERVICE BULLETIN

PRODUCT: Computer Monitor
BULLETIN: MON00-003
MODEL: DP17LT, DP17LS

SUBJECT: Bright Back Raster with Retrace Lines

BACKGROUND: Due to a high current draw from the fly-back transformer, resistors R508 or R509 may open. This will cause maximum brightness with retrace lines on the display.

SOLUTION: Remove 1.5M resistors R508 and R509. Replace R509 with a 1M-ohm ½ watt resistor. Replace R508 with a 1M-ohm ½ watt resistor. Also, add a 1M-ohm ½ watt resistor in series with R508. Designate the added resistor as R522. See diagram on page 2.

PARTS LIST: See Below

ORIGINAL			NEW	
Location No.	Part No.	Description	Part No.	Description
R508	2001-001052	1.5MOHM,5%,1/2W, Carbon	2002-000121	1MOHM,5%,1/2W, R-Composition
R509	2001-001052	1.5MOHM,5%,1/2W, Carbon	2002-000121	1MOHM,5%,1/2W, R-Composition
R522	NA	NA	2002-000121	1MOHM,5%,1/2W, R-Composition

Disclaimer: This information is provided “as is” without warranty of any kind either expressed or implied, including, but not limited to, the implied warranties of merchantability and fitness for a particular purpose.

Circuit Diagram

