



SERVICE BULLETIN

PRODUCT: CRT Monitor
BULLETIN: MON01-003
MODEL: PG19NS

SUBJECT: Horizontal Size/Width Instability

BACKGROUND: A problem may occur where the H-size becomes smaller than normal or the H-position becomes unstable while warming up after power on.

SOLUTION: As of September 2000, a change was made to the horizontal deflection circuit.

PARTS LIST: See below.

ORIGINAL			NEW	
Location No.	Part No.	Description	Part No.	Description
R409	2001-000110	10 ohm, ¼ W	2001-000456	2.2 ohm, ¼ W
BD402	3301-000011	1.2uH		Delete
D401	0402-000249	RG4 DIODE	0402-000273	31DF4, DIODE
BEAD				ADD A BEAD BETWEEN ANODE OF D401 & GROUND

Disclaimer: This information is provided “as is” without warranty of any kind either expressed or implied, including, but not limited to, the implied warranties of merchantability and fitness for a particular purpose.