



SERVICE BULLETIN

Product: CRT MONITOR
Model: AQ17HS/IS, AQ19IS/MS
 SyncMaster 700IFT, 750P, 900IFT, 950P

Bulletin No.: MON02-001 (01-C/M-E0050)
Bulletin Date: October 24, 2001
ECN Date: October 24, 2001

SUBJECT: DY-Wire Clamp Change

Background: The DY-Wire of the SyncMaster 700IFT, 750P, 900IFT, and 950P CRT monitors can cause arcing and other damage.



Cause: The DY-wire can touch the sharp edge of the high voltage FET heat sink. This can cause the wire shield to peel off thus causing an arc.

Solution: Change the routing method and clamp shape. This should be checked on all monitors manufactured before November 2001. (Refer to pictures on page 2 and 3).

Application Date: November 1, 2001

ORIGINAL			NEW	
Location No.	Part No.	Description	Part No.	Description
Cable Clamp	6502-000135	DAWS-2NA,1D10, -, NTR, NYLON66	6502-001058	DAWH-50N,ID16.6,-,NYLON6/6,NTR

BEFORE CHANGE

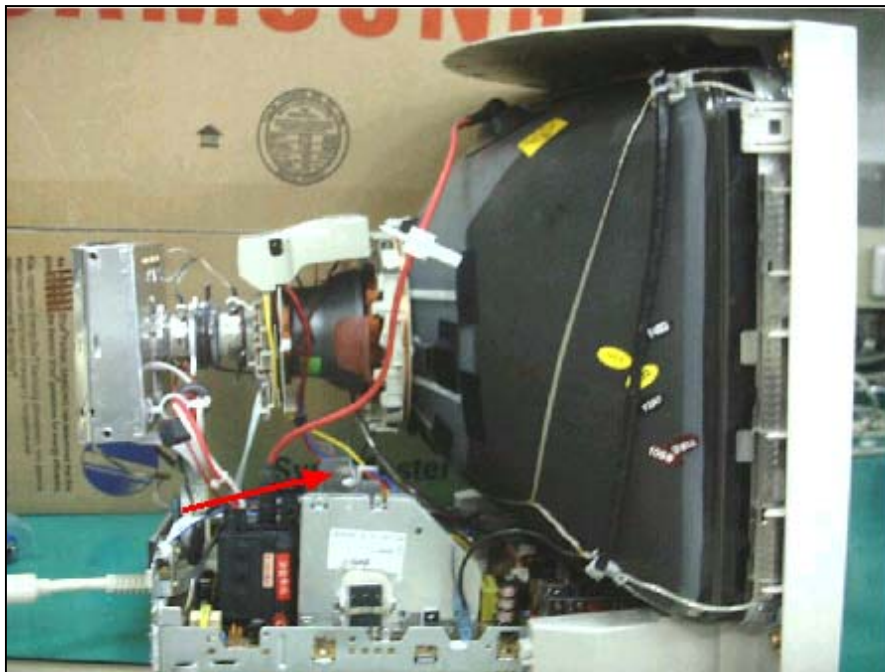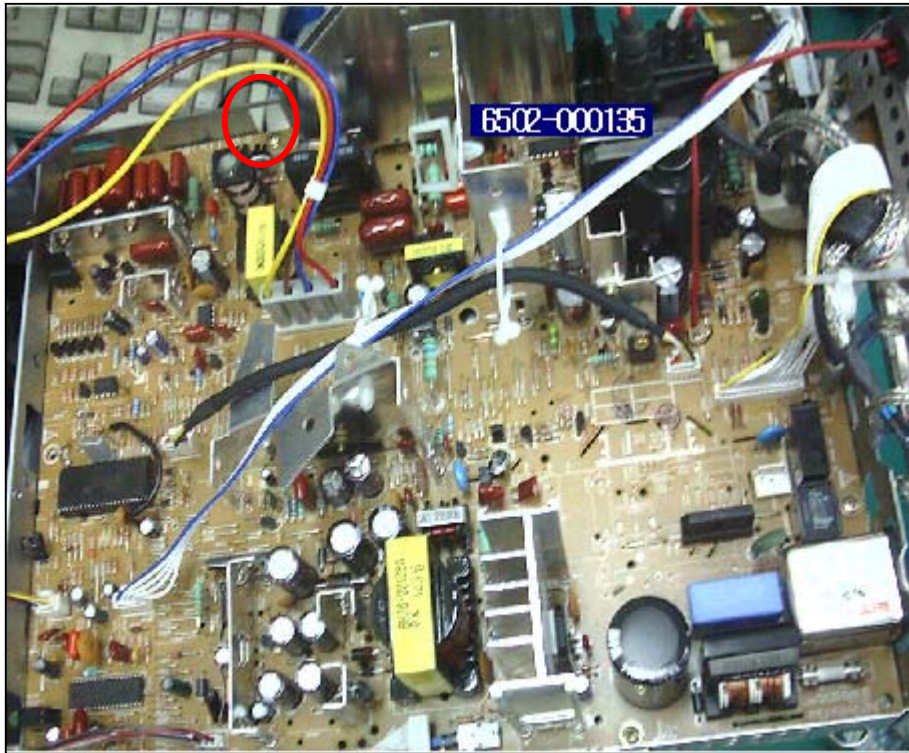

AFTER CHANGE

