

**Product:** CRT MONITOR  
**Model:** AQ17LS  
 SyncMaster 750S


**Bulletin No.:** MON02-006 (02-C/M-E0067)  
**Bulletin Date:** July 27, 2002  
**ECN Date:** July 27, 2002

**SUBJECT:** Electronic Shock

**Background:** There may be a leakage current problem with the AQ17LS model monitor if used in a building that has no grounding system (earth ground). Because of this, the user may feel a slight electronic shock when touching the screen or D-sub connector.

**Cause:** Capacitors C603 and C604.

**Solution:** Change the value of capacitors C603 and C604.

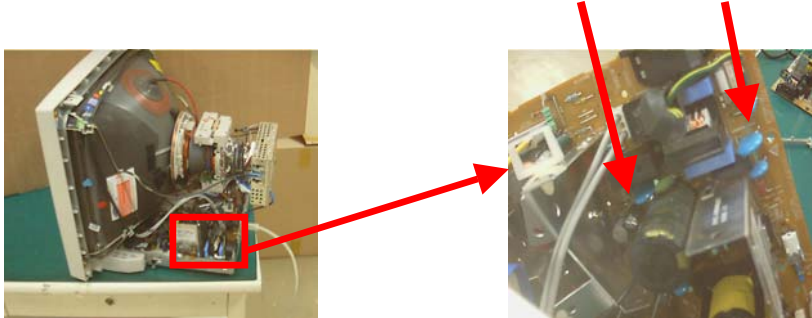

**Application Date:** July 27, 2002

ORIGINAL			NEW	
Location No.	Part No.	Description	Part No.	Description
C603	2201-000024	C-Ceramic Disk, 4.7nf, 20%, 250V	2201-000023	C-Ceramic Disk, 2.2nf, 20%, 125V
C604	2201-000024	C-Ceramic disk, 4.7nf, 20%, 250V	2201-000023	C-Ceramic Disk, 2.2nf, 20%, 125V