



SERVICE BULLETIN

Product: CRT MONITOR
Model: PG22NS
(SyncMaster 1200NF)

Bulletin No.: MON02-009 (02-C/M-E0080)
Bulletin Date: August 26, 2002
ECN Date: August 21, 2002

SUBJECT: Sync Problem

Background: An abnormal pulse may be sent to the micom by turning the power switch on and off rapidly and repeatedly. This can cause a mismatch between the control board and the micom, causing improper operation.

Cause: CS228.

Solution: Change the characteristics of capacitor CS228.

Application Date: August 20, 2002

ORIGINAL			NEW	
Location No.	Part No.	Description	Part No.	Description
CS228	2305-000665	C-FILM, MPEF; 100nF, 5%, 63V	2305-000412	C-FILM, MPEF; 470nF, 5%, 63V