



SERVICE BULLETIN

Product : CRT monitor	Bulletin No. : 01-C/M-E0044
Model : DP17L	Bulletin Date : Oct.04,2001
	ECN Date : Oct.04,2001
SUBJECT : DP17L flickering (Vertically vibration)	

Background : DP17L monitor may have flickering symptom.(Display vibrates vertically)

The flickering symptom can happen in very humid environment.

Samsung implemented countermeasure from April.2001

This symptom occurs on DP17L model which produced between Sep.2000 and April.2001

Model name : DP17L

Solution Replace resistors as below specification

R304 : R-MF, 1/4W, 15kohm --> R-MF, 1/4W, 4.7kohm

R306 : R-MF, 1/4W, 4.7kohm --> R-MF, 1/4W, 1.5kohm

Application Date : Oct.04,2001

(Interchangeability Code : * I.C)

Location No.	OLD (before) Parts		NEW (changed) Parts		* I.C
	SEC Code	Description	SEC Code	Description	
R304	2004-000344	R-METAL;15Kohm,1%,1/4W, AA,TP,2.4x6.4mm	2004-00089	R-METAL;4.7Kohm,1%,1/4W, AA,TP,2.4x6.4mm	C
R306	2004-000899	R-METAL;4.7Kohm,1%,1/4W, AA,TP,2.4x6.4mm	2004-000150	R-METAL;1.5Kohm,1%,1/4W, AA,TP,2.4x6.4mm	

Type	A type	B type	C type	D type	E type	F type
Interchange Type Code (* I.C)	OLD (Parts) → Early (Prod.) NEW → Late	OLD (Parts) → Early (Prod.) NEW → Late	OLD (Parts) → Early (Prod.) NEW → Late	OLD (Parts) → Early (Prod.) NEW → Late	Parts Addition (None New)	Parts deletion (Old Del.)

Application Reference () Only Defected sets () Whole sets ()

Attachment Schematic Diagram () Component Lay-out () Exploded View ()
 Mechanical Diagram () None () Others ()

Product Month : - Aug all **Serial No.** (~ from)

Published by : C.J.Oh **Checked by :** C. K.Park **Approved by :** Y.K.Yoo