

Product : CRT monitor

Bulletin No. : 01-C/M-E0050

Model : AQ17HS/IS, AQ19IS/MS

Bulletin Date : Oct.24,2001

ECN Date : Oct.24,2001

SUBJECT : DY-Wire foaming change

Background : DY-wire forming of AQ17HS/IS & AQ19IS/MS model have design problem.
 DY-wire can be touch with sharp edge of high voltage FET heat sink. this case, calbe could peel off.
 This peel off cause spark and some other accident.
 Samsung changed DY-wire clamp shape and forming method from Nov.01,2001

Model name : AQ17HS/IS, AQ19IS/MS

Solution When repairing upper monitor model check wire condition.(if produced before Nov.2001)
 If wire and clamp shape is old version please change clamp and wire forming method.
 (refer to attached pictures)

Application Date : -

(Interchangeability Code : * I.C)

Location No.	OLD (before) Parts		NEW (changed) Parts		* I.C
	SEC Code	Description	SEC Code	Description	
Cable clamp	6502-000135	DAWS-2NA,ID10,-,NTR,NYLON66	6502-001058	DAWH-50N,ID16.6,-,NYLON6/6,NTR	C

Type	A type	B type	C type	D type	E type	F type
Interchange Type Code (* I.C)	OLD (Parts) → Early (Prod.) NEW → Late	OLD (Parts) → Early (Prod.) NEW → Late	OLD (Parts) → Early (Prod.) NEW → Late	OLD (Parts) → Early (Prod.) NEW → Late	Parts Addition (None New)	Parts deletion (Old Del.)

Application Reference () Only Defected sets () Whole sets ()

Attachment Schematic Diagram () Component Lay-out () Exploded View ()
 Mechanical Diagram () None () Others ()

Product Month : - Aug all

Serial No. (~ from)


Published by : C.J.Oh

Checked by : C. K.Park

Approved by : Y.K.Yoo

* Bulletin No: 01-C/M-E0050

BEFORE

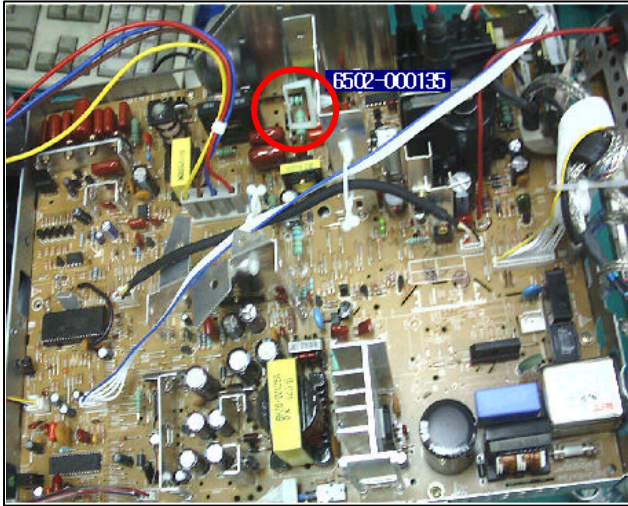

AFTER (long type)

