

Product : CRT monitor	Bulletin No : 02-C/M-E0081
Model : AQ19L,AQ19J*	Bulletin Date : Aug.28,2002
	ECN Date : Aug.28,2002

SUBJECT : Before service to prevent touch PCB pattern and metal guide

Background : The 540V PCB pattern can touch with metal chassis guide part although pattern covered with protection paint.
 In this case cause some parts failure (R513/R570)
 Problem range : PCB ver MP 1.2 ~ MP 1.4 (Production: Oct.2001 ~ Aug.2002)
Permanent solution : Change PCB pattern from ver 1.4 to ver 1.5 (Sep.2002~)

Model name : AQ19L* / AQ19J*

Solution Do "+1" service for all returned units if its PCB ver is MP1.2 ~ MP1.4.
 Bend metal guide to prevent touch with PCB pattern.
 Refer to additional information for detail work instruction.


Application Date : Aug.28,2002

(Interchangeability Code : * I.C)


Location No.	OLD (before) Parts		NEW (changed) Parts		* I.C	
	SEC Code	Description	SEC Code	Description		
Type	A type	B type	C type	D type	E type	F type
Interchange Type Code (* I.C)	OLD → Early (Parts) / NEW → Late (Prod.) OLD → Late (Parts) / NEW → Early (Prod.)	OLD → Early (Parts) / NEW → Late (Prod.) OLD → Late (Parts) / NEW → Early (Prod.)	OLD → Early (Parts) / NEW → Late (Prod.) OLD → Late (Parts) / NEW → Early (Prod.)	OLD → Early (Parts) / NEW → Late (Prod.) OLD → Late (Parts) / NEW → Early (Prod.)	Parts Addition (None New)	Parts deletion (Old Del.)
Application	Reference ()	Only Defected sets ()	Whole sets ()			
Attachment	Schematic Diagram ()	Mechanical Diagram ()	Component Lay-out ()	None ()		Exploded View ()
Product Month :	Oct.2001 ~ Aug. 2002		Serial No. (~ from)			
Published by :	C.J.Oh	Checked by :	M.S.Park	Approved by :		K.S.Yeo

* Bulletin No: 02-C/M-E0081

Main PBA

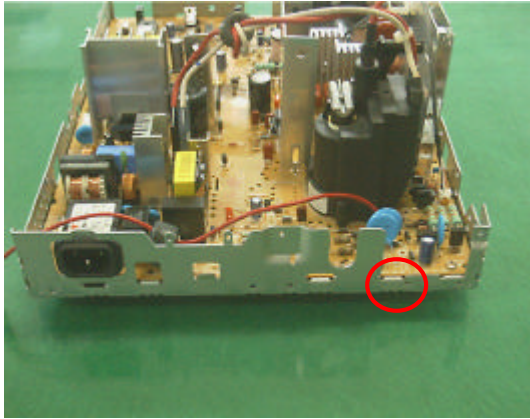

PCB guide part of metal chassis

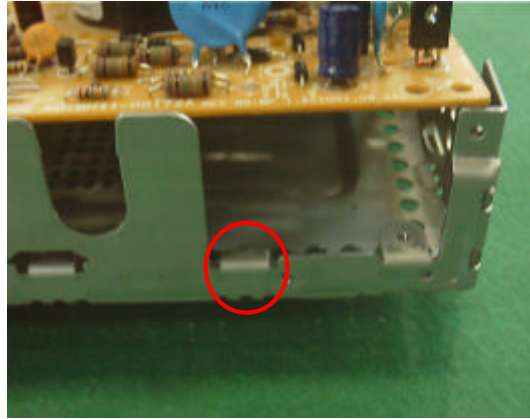

Bend the guide to down side with tool carefully.

Bending angle : 45 degree

