

Product: CRT MONITOR
Model: AN19J*, AN19L*, CA19J*

Bulletin No.: MON02-016 (02-C/M-E0102)
Bulletin Date: December 10, 2002
ECN Date: December 10, 2002

SUBJECT: DPMS Noise

Background: A whistling sound occurs when the monitor goes into DPMS mode.

Cause: The current of IC601 is abnormal during the off mode causing T601 to vibrate.

Solution: Change the value of capacitor C614 from 10nf to 2.2nf.



Application Date: December 10, 2002

ORIGINAL			NEW	
Location No.	Part No.	Description	Part No.	Description
C614	2201-000019	C-CER, 500V, 10NF	2201-000325	C-CER, 500V, 2.2NF