

TELEVISION TECHNICAL BULLETIN

MODELS 28HW53H 32HW53H 66FW53H 66GF63H

SYMPTOM During the sub-title mode the set may intermittently revert to page 100. This may happen after changing channels or while watching a particular channel for any length of time.

ACTION Please change the EEPROM software as detailed in the table below.

<u>REF NO</u>	<u>DESCRIPTION</u>	<u>PART NUMBER</u>	<u>FILE VERSION</u>	<u>PRICE CODE</u>
IC 1002	EPROM SET 4M 3V FLASH 28HW53H	CH-IX1841CJH0	H0-00x25	AM
IC 1002	EPROM SET 4M 3V FLASH 56FW53H	CH-IX1841CJH5	H9-04x07	AM
IC 1002	EPROM SET 4M 3V FLASH 66FW53H	CH-IX1841CJH3	H5-04x07	AM
IC 1002	EPROM SET 4M 3V FLASH 66GF63H	CH-IX1841CJH7	H7-02x04	AM

Sharp Electronics (UK) Limited

Reference SP023900X

Revision 1

White – Carry out as required
Yellow – Carry out as required and whenever the unit comes in for service
Red – Carry out on all units