

TELEVISION TECHNICAL BULLETIN

<u>MODELS</u>	56FW53H	66FW53H	66FW54H	76FW53H
	76FW54H	66GF63H	66GF64H	76GF63H
	76GF64H	59ESD7H	66ESD7H	28HW53H
	32HW53H			

SYMPTOM Set Resets whilst being watched or Switches on from Stand-by on its own.

CAUSE Problem with Slave microprocessor ON TIMER function.

ACTION Remove the parts listed below (IC701, R708, and C728). See location parts on next page.

<u>REF NO</u>	<u>DESCRIPTION</u>	<u>PART NUMBER</u>	<u>PRICE CODE</u>
IC701	Reset IC REMOVE	-	-
R708	Resistor REMOVE	-	-
C728	Capacitor REMOVE	-	-

Sharp Electronics (UK) Limited

Reference SP014701X


Revision 1




White – Carry out as required
Yellow – Carry out as required and whenever the unit comes in for service
Red – Carry out on all units

TELEVISION TECHNICAL BULLETIN

MOTHER BOARD

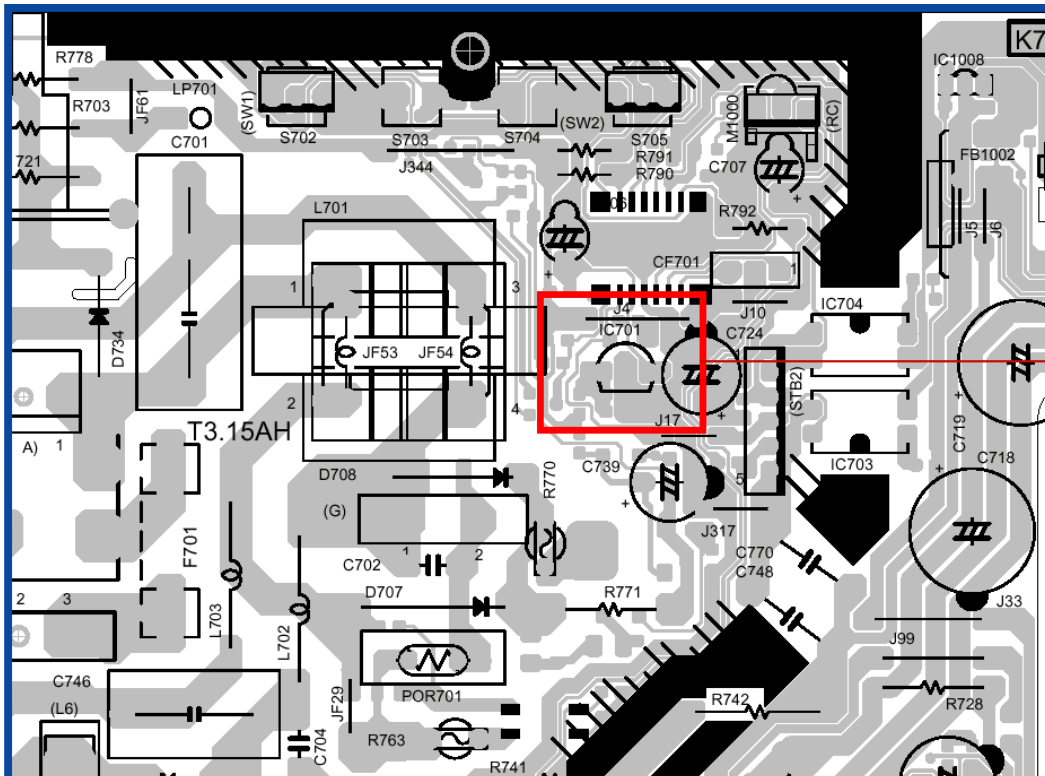

IC 701

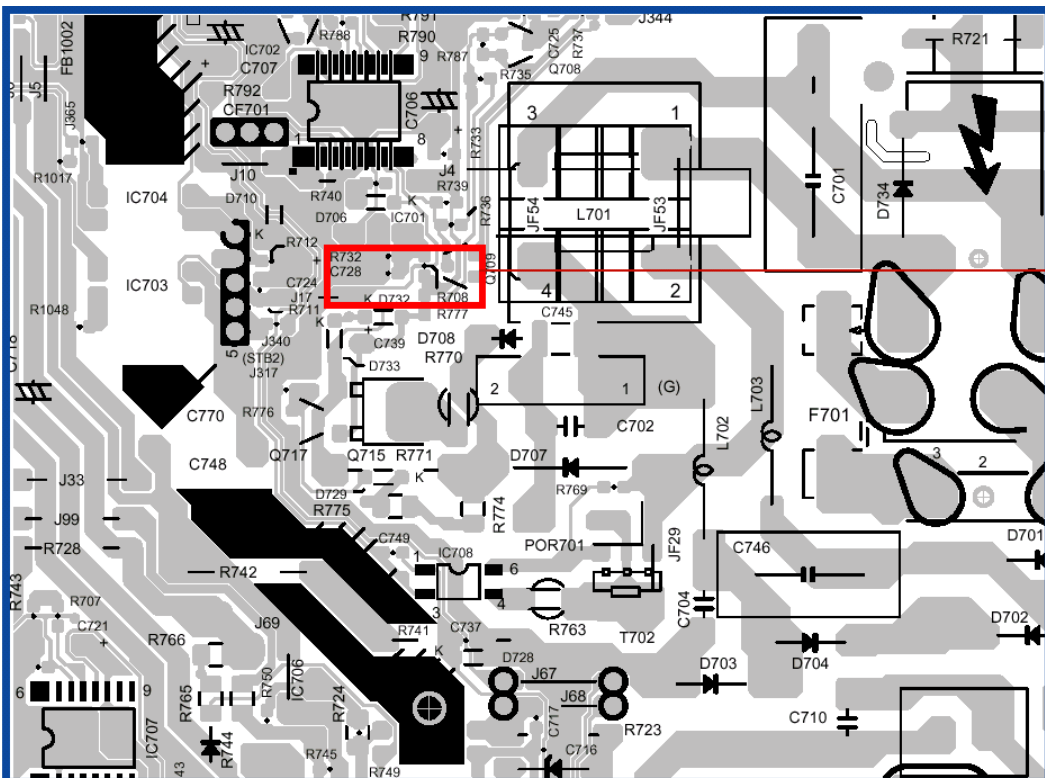

R708
C728

Sharp Electronics (UK) Limited

Reference SP014701X

Revision 1



White – Carry out as required

Yellow – Carry out as required and whenever the unit comes in for service

Red – Carry out on all units