

TELEVISION TECHNICAL BULLETIN

MODELS **28HW53H** **32HW53H** **66GF63H**

SYMPTOM Volume goes up when a non-Sharp (e.g. SKY) remote is used in the vicinity

ACTION Replace software (IC1002) as described below

Take care to note the CRT maker, the Device type fitted as IC1002 and also the device used for IC801

<u>MODEL NO</u>	<u>ROM TYPE</u>	<u>IC801</u>	<u>CRT TYPE</u>	<u>PART NUMBER</u>	<u>PRICE CODE</u>
28HW53H	37VF040	N/A	Thomson	28HW53HVOLUME	AX
32HW53H	37VF040	N/A	Thomson	28HW53HVOLUME	AX
66GF63H	37VF040	VDP3120 / 3104	Philips	H8-00X07-BINP	AX
	37VF040	VDP3120 / 3104	Thomson	H7-01X07-BINT	AX
	37VF040	VDP3130	Thomson	H7-02X05-BINY	AX
66GF63H	27C4001	VDP3120 / 3104	Philips	H4-01X02-BINE	AX

NOTE : **Do not Blank the NVM when replacing IC1002**

Sharp Electronics (UK) Limited

Reference PG09042003-1

Revision 1

White – Carry out as required
Yellow – Carry out as required and whenever the unit comes in for service
Red – Carry out on all units