



Month of Issue: January 1999

Classification:

TELEVISION TECHNICAL BULLETIN

Page 1 of 1

MODELS 37AM12H 37AM23H 37AT25H 51AT15H

> 37DT25H 37ET35H 37DM23H 37EM33H

51DT25H

REASON As the NVM (IC1002) is supplied with default values for a number of models, it is

necessary to reprogram the device on its installation.

ACTION Depending on the model number, reprogram the NVM as follows.

37AM12H

Location 0B Value 98

37AM23H, 37AT25H, 51AT15H

Location 0B Value B8

37DM23H, 37EM33H, 37DT25H, 37ET35H, 51DT25H

Location 0B Value F8

Location 47 Value 70

Note that location 47 changes the OSD position and may need adjusting slightly.

For a full explanation of these codes, please refer to the service manual

