

CTV2000 03 10


Page 1 of 1

Month of Issue: March 2000 Classification: White

## **TELEVISION TECHNICAL BULLETIN**

MODELS 37AM12H 37AM23H 37AT25H

- **<u>SYMPTOM</u>** Tuner drift.
- **CAUSE** C1026 (VCO decoupling microprocessor output).
- ACTION Replace C1026

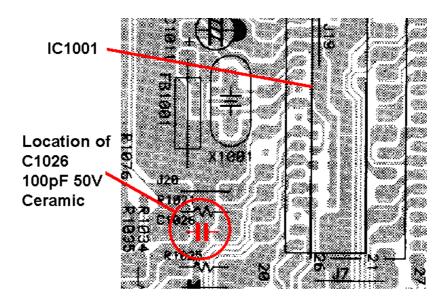

REF NO PART NUMBER

DESCRIPTION

## PRICE CODE

C1026 VCCSPA1HL101J

Capacitor, 100pF 50V Ceramic

AA

Sharp Electronics (UK) Limited Reference GW22032000-1 Revision 1



White – Carry out as required Yellow – Carry out as required and whenever the unit comes in for service Red – Carry out on all units