

Date of Issue: 10/02/97 Classification: Yellow

## TELEVISION TECHNICAL BULLETIN

Page 1 of 2

<b>MODELS</b>	51CS03H	51CS05H	59CS03H
	59CS05H	66CS03H	66CS05H

**SYMPTOM** If there is a failure of any component within the vertical deflection circuit or if a set comes in for service then carry out the improvement detailed below.

**ACTION** 

- 1. Add a new diode (1N4148) from the emitter of Q509 to the cathode of D513, cathode of diode to the emitter of Q509.
- 2. Replace R534 with a 390R.
- 3. Solder a fuse (QFS-J1023CEZZ) in series with L607.
- 4. Solder a fuse (QFS-J1023CEZZ) in series with L608.

Refer to the diagrams given below.

REF NO	<u>DESCRIPTION</u>	PART NUMBER	PRICE CODE
-	Diode, 1N4148	RH-DX0045BMZZ	AA
R534	Resistor, 390R 1/10W	VRS-TV1JD331J	AA
-	Fuse, 1A	QFS-J1023CEZZ	AA

