

TELEVISION TECHNICAL BULLETIN

<u>MODELS</u>	51CS03H	59CS03H	66CS03H
	51CS05H	59CS05H	


SYMPTOM When used in a hot environment a bleeping sound may be heard from the speakers or there is intermittent sound loss.

CAUSE Pin 22 of IC301 floating.

ACTION Insert wire link between pin 22 of IC301 and ground as indicated in the diagram below.

To make the insertion of this link easier remove X301, fit wire, then replace X301.

<u>REF NO</u>	<u>DESCRIPTION</u>	<u>PART NUMBER</u>	<u>PRICE CODE</u>
-	Wire Link, 20mm	VW7UGB0-020AA	AA

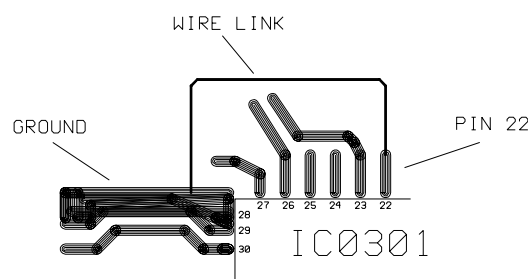

Location of wire link on component side of PWB