

**TELEVISION TECHNICAL BULLETIN**

<b><u>MODELS</u></b>	<b>51CS03H</b>	<b>51CS05H</b>	<b>59CS03H</b>
	<b>59CS05H</b>	<b>59CSD8H</b>	<b>66CS03H</b>
	<b>66CS05H</b>	<b>66CSD8H</b>	

**SYMPTOM** Intermittent sound. May be especially noticeable on channel change.

**CAUSE** Erratic response of the multi-standards processor, IC301.

**ACTION** Connect a 47nF, 63V polyester capacitor from pin 61 of IC301 to ground.  
Use the part number given below for the capacitor.

<b><u>REF NO</u></b>	<b><u>DESCRIPTION</u></b>	<b><u>PART NUMBER</u></b>	<b><u>PRICE CODE</u></b>
-	Capacitor, 47nF 63V	RC-FZ9473BMNJ	AC