

TELEVISION TECHNICAL BULLETIN

<u>MODELS</u>	51CS03H	51CS05H	59CS03H	59CS05H
	59CSD8H	66CS03H	66CS05H	66CSD8H

SYMPTOM A bright line appears at the top of the frame (approximately one-inch down) if it is adjusted correctly. Usually the customer complains that the frame has come down about half an inch at the top of the picture (no fold over). This cannot be removed by adjustment.

CAUSE Failure of C512 or C517.

ACTION Replace C512 and C517 (22uF, 25V).