

TELEVISION TECHNICAL BULLETIN

<u>MODELS</u>	51CS03H	51CS05H	59CS03H	59CS05H
	59CSD8H	66CS03H	66CS05H	66CSD8H

SYMPTOM No or intermittent sound.

CAUSE D333 breaking down intermittently.

ACTION Replace D333 using the part number given below.

<u>REF NO</u>	<u>PART NUMBER</u>	<u>DESCRIPTION</u>	<u>PRICE CODE</u>
D333	RH-EX0544BMZZ	Zener diode, 4.7V	AA