

TELEVISION TECHNICAL BULLETIN

<u>MODELS</u>	51DS02H	51DS03H	51DS05H	59DS03H
	59DS05H	66DS03H	66DS05H	66ES05H
	66ES03H	59ESD7H	66ESD7H	

SYMPTOM The receiver does not come out of standby - power supply inoperative.

CAUSE R713 and / or R714 going high or open circuit.

ACTION Replace R713 and R714 with 560k Ω 1/2W metal film resistors.
Use the part numbers below.

<u>REF NO</u>	<u>DESCRIPTION</u>	<u>PART NUMBER</u>	<u>PRICE CODE</u>
R713	Resistor 560k Ω 1/2W metal film	VRC-MA2HG564J	AA
R714	Resistor 560k Ω 1/2W metal film	VRC-MA2HG564J	AA