

TELEVISION TECHNICAL BULLETIN

MODELS 51AT15H

SYMPTOM Tuner drifts off tune.

CAUSE VT line drive current variations.

ACTION Change the resistors as indicated, using the part numbers given below.

1. Change R205 from a 33k to 6.8k.
2. Change R1034 from a 33k to a 8.2k.
3. Change R1035 from a 100k to a 22k.
4. Change R1077 from a 22k to a 4.7k.

<u>REF NO</u>	<u>DESCRIPTION</u>	<u>PART NUMBER</u>	<u>PRICE CODE</u>
R205	Resistor 6.8k, 1/8W	VRD-RA2BE682J	AA
R1034	Resistor 8.2k, 1/8W	VRD-RA2BE822J	AA
R1035	Resistor 22k, 1/8W	VRD-RA2BE223J	AA
R1077	Resistor 4.7k, 1/8W	VRD-RA2BE472J	AA

Sharp Electronics (UK) Limited CE Technical Support Group

Originator AW Supervisor _____ Approval Date ___/___/___ Reference UK71902X

White - Carry out as required Yellow - Carry out as required and whenever unit comes in for service Red - Carry out on all units

