

## TELEVISION TECHNICAL BULLETIN

**MODELS** 51AT15H

**SYMPTOM** Intermittent loss of sound and/or colour for approximately half a second (flashing on screen).

**CAUSE** Poor response of the colour ID and AGC circuits.

**ACTION** Change the following components to the values specified below.

1. C209 to 100nF, 50V. This was originally 1uF.
2. C808 to 47nF, 50V. This was originally 100nF.

Note that capacitor C808 is a surface mount component and must be replaced with the correct type. Use the part numbers given below for these capacitors.

<b><u>REF NO</u></b>	<b><u>DESCRIPTION</u></b>	<b><u>PART NUMBER</u></b>	<b><u>PRICE CODE</u></b>
C209	Capcitor 100nF, 50V	VCEAGA1HW104M	AA
C808	Capactor 47nF, 50V	VCKYTV1HB473K	AA