

## TELEVISION TECHNICAL BULLETIN

**MODELS**      66FW53H                      66FW54H                      76FW53H                      76FW54H

**SYMPTOM**    NVM corruption.


**CAUSE**        Arcing can occur on the CRT base panel (PWB-B) caused by CRT discharges.

**ACTION**        Add capacitors C1826 and C1827 as shown in the picture below.

Models produced after the following serial numbers already have the capacitors fitted:

66FW53H	726200
66FW54H	714595
76FW53H	713664
76FW54H	714633

<u>REF NO</u>	<u>DESCRIPTION</u>	<u>PART NUMBER</u>	<u>PRICE CODE</u>
C1826	Ceramic capacitor 4.7nf 10% 500V	VCKYPA2HB472K	AB
C1827	Ceramic capacitor 10nf 20% 250V	RC-KZ0029CEZZ	AC

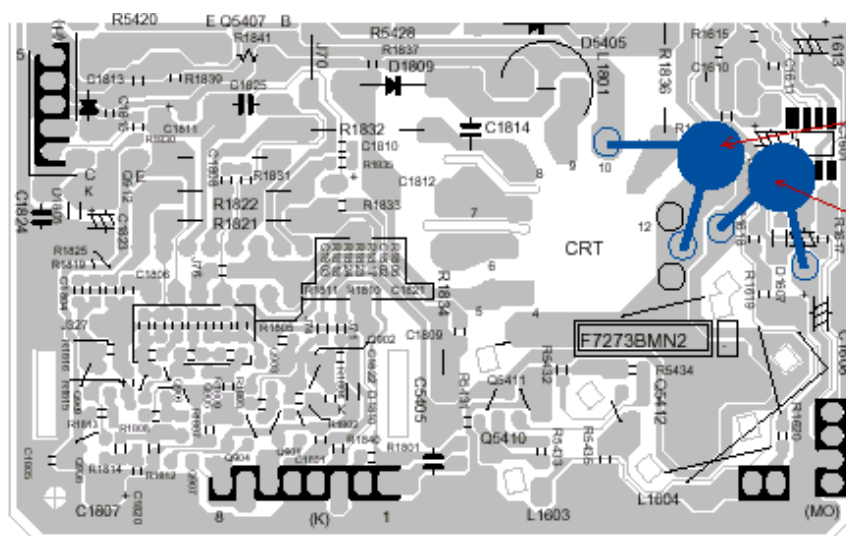

**C1827: Pin 10&12  
CRT Socket.**

**C1826: Q5405 &  
Q5411 collectors  
track.**

**Sharp Electronics (UK) Limited**

Reference UK003400X

Revision 2



White – Carry out as required

Yellow – Carry out as required and whenever the unit comes in for service

Red – Carry out on all units