

MODELS 66FW53H

SYMPTOM In some receivers, the vertical shift may be incorrect.

CAUSE Offset value in the NVM for the vertical shift is not equal to that set in the EPROM.

ACTION Check the data within the NVM at page 0D position 72.

If it is 00 carry out procedure A below.

If it is 90 carry out procedure B below.

Procedure A

- 1) Go to page 00 and increase position 2C by 20 steps and memorise by pressing the standby button on the remote control.
- 2) Go to the V-Shift adjustment and correct the vertical position (if necessary), then memorise.

Procedure B

- 1) Go to page 0D, position 72 and change to 00, then memorise by pressing the standby button on the remote control.
- 2) Go to page 00 and increase position 2C by 20 steps then memorise.
- 3) Go to the V-Shift adjustment and increase the value by 20 steps and memorise.