

MODELS 66GS62H

SYMPTOM Q701 in the power factor circuit fails at switch on or intermittently

CAUSE R705 high or open circuit.

ACTION Replace R705 using the part number given below.

<u>REF NO</u>	<u>DESCRIPTION</u>	<u>PART NUMBER</u>	<u>PRICE CODE</u>
R705	Resistor, 8.2k 1/10W SMD	VRS-TV1JD822J	AA

Sharp Electronics (UK) Limited

Reference AM/JR20052003-1

Revision 1

White – Carry out as required

Yellow – Carry out as required and whenever the unit comes in for service

Red – Carry out on all units