


TELEVISION TECHNICAL BULLETIN

MODELS 51CS03H 59CS03H 66CS03H

SYMPTOM No or intermittent vertical output.

CAUSE Intermittent solder joint on L501.

ACTION Resolder joint on L501 as shown in the diagram below.

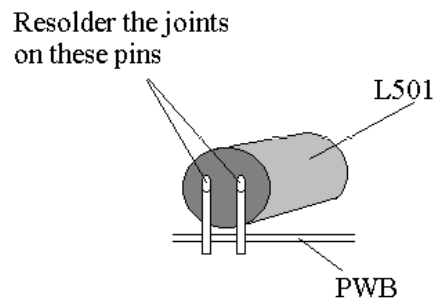

Points to resolder on L501