

**TELEVISION TECHNICAL BULLETIN**

<b><u>MODELS</u></b>	51CS03H	51CS05H	59CS03H	59CS05H
	59CSD8H	66CS03H	66CS05H	66CSD8H

**SYMPTOM** Intermittent failure of the line output transistor, the receiver may not start up, or start up is intermittent.

**CAUSE** Dry joint(s) on scanning coil PWB.

**ACTION** If any of the above models come in for service, unclip the small PWB on the scanning coils and resolder the connections.

Also resolder the scanning coil connections if a chassis has been exchanged for any of the above symptoms.