

TELEVISION TECHNICAL BULLETIN

MODELS 51CS03H 59CS03H 66CS03H

SYMPTOM If used in a hot environment, the picture can become saturated with red, green or blue blanking lines.

CAUSE Build up of flux around transistors on the CRT Socket PWB, causing tracking between them.

ACTION 1. Remove SMD transistors Q870, Q871 and Q872.
 2. Clean the exposed areas with a bristle brush impregnated with alcohol.
 3. Clean the SMD transistors with alcohol.
 4. Replace the transistors.