

TELEVISION TECHNICAL BULLETIN

MODELS DV51083H DV59083H DV5903H DV66083H

 DV6603H

SYMPTOM Set starts up then immediately shuts down again.

CAUSE Overload in the line stage or incorrect beam current limiter feedback.

ACTION Check or replace T601, R628 and / or R749.

<u>REF NO</u>	<u>DESCRIPTION</u>	<u>PART NUMBER</u>	<u>PRICE CODE</u>
T601	51cm LOPT	RTRNF1786BMZZ	BG
T601	59/66cm LOPT	RTRNF1783BMZZ	BH
R628	Resistor 1k 0.5W	Source locally	-
R749	Resistor 10k 0.5W	Source locally	-

Sharp Electronics (UK) Limited

Reference TVMAGJUNE2000-A

Revision 1



White – Carry out as required
Yellow – Carry out as required and whenever the unit comes in for service
Red – Carry out on all units